

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

## Purpose

The purpose of this procedure is to describe all steps involved in the measurement of air-kerma using the four primary x-ray standard free-air ionization chambers required for the calibration service listed as 46010C and 46011C [1]. The procedures for the test of high-quality electrometers 46030S is also described.

## Scope

The calibration and irradiation of instruments that measure x-rays are performed in terms of the physical quantity air-kerma. The process for establishing calibration coefficients (or factors) for radiation detectors is explained in this procedure. Calibrations are performed by comparing the instrument to a NIST primary standard, which include four free-air chambers for x rays.

## Referenced documents

International Organization for Standardization

ISO/IS 4037-1:1996 X and gamma reference radiations for calibrating dosimeters and dose rate meters and for determining their responses as a function of photon energy--Part 1.: Radiation characteristics and production methods

National Institute of Standards and Technology

NBS Special Publication 250-16 Calibration of X-ray and Gamma Measuring Instruments

NIST Special Publication 250-58 Calibration of X-ray and Gamma-ray Measuring Instruments

NIST Calibration Services Users Guide 1998

NBS Handbook 64 Design of Free-Air Ionization Chambers

NBS Handbook 78 Report of the International Commission on Radiological Units and Measurements

NIST Special Publication 811 Guide for the Use of the International System of Units (SI)

NIST Technical Note 1297 Guidelines for Evaluating and Expressing the Uncertainty of NIST Measurements

## Records

Laboratory databooks

Binders

## Definitions

air kerma - the quotient of  $dE_{tr}$  by  $dm$ , where  $dE_{tr}$  is the sum of the initial kinetic energies of all electrons liberated by photons in a volume element of air and  $dm$  is the mass of air in that volume element. The SI unit of air kerma is the gray (Gy).

beam quality - used to refer to a specific x-ray beam with a characteristic half-value layer and produced by a constant potential kilovoltage.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	1 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

calibration - the process whereby the response of a dosimeter or measuring instrument is characterized through comparison with an appropriate national standard.

calibration coefficient - the quotient of the air kerma in the absence of the chamber and the charge generated by that radiation in the ionization chamber, expressed in units of Gy/C.

calibration factor - the quotient of the air kerma or exposure in the absence of the chamber and the electrometer reading with the ionization chamber, and is dimensionless.

effective energy - the energy of monoenergetic x-ray beam that has the same half-value layer as the spectrum in question.

exposure - exposure ( $X$ ) is the quotient of  $dQ$  by  $dm$ , where  $dQ$  is the sum of the electrical charges on all the ions of one sign produced in air when all the electrons are completely stopped in air of mass  $dm$ . The SI unit of exposure is the coulomb per kilogram (C/kg); the special unit of exposure, the roentgen (R), is equal to exactly  $2.58\text{E-}4$  C/kg.

half-value layer - (HVL) the thickness of the specified material added as a beam attenuator that reduces the air-kerma rate by one half of the unattenuated-beam air-kerma-rate value.

homogeneity coefficient - (HC) the ratio of the first to the second half-value layer.

monitor instrument - an instrument used to monitor the stability of the air-kerma rate during an irradiation.

a

quarter-value layer - (QVL) the thickness of the specified material added as a beam attenuator that reduces the air-kerma rate to one quarter of the unattenuated-beam air-kerma-rate value.

second half-value layer - the difference between the quarter-value layer and the half-value layer.

x-ray unit - system comprising of a high-voltage generator, an x-ray tube and an x-ray controller.

## Key words

air kerma; calibration; exposure; free-air chamber; half-value layer; ionization chambers; mammography chamber calibrations; primary standard; standard; uncertainty estimate; x rays.

## Background information

The quantity air kerma characterizes a beam of photons or neutrons in terms of the energy transferred to any material. For the calibration procedures described in this document, consideration is limited to photon beams in air. A complete description of the determination of air kerma and the traceability of the standards is found in sections 4.1, 6.2 and 6.8 of the NIST Special Publication 250-58.

## Requirements of instruments to be calibrated

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	2 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

Only ionization chambers known to be stable and reproducible are accepted for calibration in this program. Institutions submitting ionization chambers for calibration are strongly urged to perform stability checks involving redundant measurements in highly reproducible radiation fields before sending their instruments to NIST, and to repeat those checks after NIST calibration, and again at suitable intervals. Instruments submitted for calibration, and material submitted for irradiation, must be shipped in reusable containers.

#### Explanation of calibration service offered

An x-ray tube produces bremsstrahlung spectra, inhomogeneous beams with photon energies from very low values to a high-energy cutoff given by the maximum potential applied to the x-ray tube. These beams are customarily filtered with a high purity metal to reduce the unwanted low-energy x-rays. Three x-ray calibration ranges are used for the calibration services. Two of the ranges contain x-ray tubes with tungsten anodes. The x-ray beams from these anodes are filtered with aluminum, copper, tin and/or lead. Two anode types are offered for the mammography calibration service, molybdenum (Mo) and rhodium (Rh). The Mo-generated x-ray beams are filtered with Mo, Al, or Rh foils, while the Rh beams are filtered with Rh and Al foils. It is conventional to characterize the "quality" of the filtered x-ray beam in terms of the thickness of aluminum or copper required to reduce the air kerma rate to 50 % and to 25 % of its original value. These thicknesses are called the half-value layer (HVL) and the quarter-value layer (QVL). The HVL and QVL measurements must be made using good-geometry attenuation in order to obtain accurate and reproducible numbers. The second HVL is the difference between the QVL and HVL. The homogeneity coefficient (HC) is the ratio of the first to the second HVL, often expressed as a percent. A HC value near 1 (or 100 %) indicates that the filtration has produced an approximately homogeneous beam that is approaching monoenergetic conditions.

The NIST tungsten x-ray beam qualities are divided into three groups according to filtration, i.e., light (L), moderate (M), and heavy (H) filtration. The beam codes consist of a letter L, M, or H, followed by the generating constant potential in kilovolts. For example, M100 indicates moderate filtration and 100 kV constant potential. The special (S) series beam codes, S60 and S75, have characteristics that are not consistent with those of the L, M, and H groups. The qualities for each group were chosen so that relatively smooth curves result for the graph of tube potential versus HVL. Table 1 gives a complete listing of the NIST beam codes currently available. Depending on the energy response and design of the ionization chamber, the calibration coefficients for a specific ionization chamber often fall on smooth curves when plotted against HVL. In this case, all calibration points have been chosen from a single group, L, M, or H. If calibration points are chosen from more than one group, discontinuities will occur, hence no attempt should be made to interpolate between such calibration factors.

The mammography beam qualities offered at NIST were chosen to cover the range of HVLs of x-ray beams found in clinical settings. The beam codes that name the beam qualities are a combination of the chemical symbol of the anode and the filter respectively, followed by the constant potential in kilovolts. The letter "x" ends the beam codes that name the exit beam qualities. The exit beam qualities, which represent the transmission of the x-rays through the

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	3 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

breast, are generated by an additional filtration of 2.0 mm of Al. The mammography beam qualities offered are listed in Table 2.

A list of all ISO beams offered at NIST is found in Table 3. The NIST H group of qualities agrees with the ISO narrow spectrum (NS) qualities recommended by the ISO document 4037. The ISO recommendations extend from 300 kV to 40 kV, below which the NIST H group has been extended to 10 kV in agreement with practice at the national metrology institute of Germany, Physikalisch-Technische Bundesanstalt (PTB). The NIST M group of qualities is in agreement with the recommendation for radiation therapy calibration in IEC Publication 731.

The selection of beam qualities for instrument calibration depends on the situation of interest. The H qualities are usually used for calibration for radiation-protection instrumentation, as these beams have the narrowest spectrum at each generating potential, and probably most nearly approximate radiation that has penetrated a protective barrier. The M qualities are usually used for calibration of radiation-therapy instruments. The L qualities are predominately for calibration of instruments used for measurement of unfiltered or lightly filtered beams that give high exposure rates, as is often the case in radiation biology and Grenz-ray therapy. The Mo and Rh beam qualities are offered to simulate the clinical mammography beams.

### Design philosophy and theory

X-ray calibrations are performed by using the substitution method. Using this method, the air kerma or air-kerma rate is determined at some point in space by a free-air chamber. The instrument to be calibrated is then placed at the same point in space as the standard and the response of the instrument is determined. The calibration coefficient is the quotient of the air kerma,  $K_{\text{air}}$  in the absence of the chamber, and the charge,  $Q$ , generated by that radiation in the ionization chamber:

$$\text{Calibration Coefficient} = \frac{K_{\text{air}}}{Q}$$

The calibration factor is the quotient of the air kerma or exposure, in the absence of the chamber, and the electrometer reading with the ionization chamber:

$$\text{Calibration Factor} = \frac{K_{\text{air}}}{\text{electrometer reading}}$$

$$\text{Calibration Factor} = \frac{X}{\text{electrometer reading}}$$

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	4 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

## X-ray range features

Three x-ray calibration ranges are available for instrument calibrations. One range is used for tungsten x-rays generated at constant potentials of 10 kV to 100 kV, the other is used for tungsten x-rays generated at potentials of 50 kV to 300 kV. The mammography x-rays are generated at constant potentials of 23 kV to 40 kV. Standardization of x-ray beams for the quantity air kerma or exposure is carried out at NIST by means of four free-air ionization chamber standards. These standards are discussed in Refs. [3, 4, 5 and 6]. Features critical to the proper use of the standards are listed in Table 4. All the standards are shown in Figure 1. Features of the x-ray systems are listed in Table 5.

## Special operating procedures for the Attix Chamber

The Attix chamber, a variable-length, cylindrical free-air chamber differs in design from the other NIST conventional parallel-plate free-air ionization chambers. The differences contribute to its appropriateness as a standard for the measurement of exposure in the mammography energy region. This measurement procedure is based on a subtraction method [13], which involves finding the difference in collected charge for different electrode lengths. The chamber is composed of an aluminum cylinder with a fixed front plate, a variable-position back plate, and an off-center electrode. The cylinder and back plate are positioned with precision stepping-motor controlled slides. For a detailed description of the chamber see Ref. [14].

The air-kerma determination with the Attix chamber involves the collection of charge with various plate configurations. By changing the volume of the Attix chamber and knowing the corresponding change in length of the collecting electrode, the air kerma can be determined with a minimum of two different plate configurations. Although the minimum number of plate configurations needed to determine the air kerma is two, four measurements are conducted, with the fourth being a repeat of the first position. The electrode length is changed by 5 cm with each plate configuration. The average of the three resulting ratios of the change in charge to change in electrode length is calculated and used in the air-kerma calculation as a component of the mass ionization current. For routine measurements, the defining point of the Attix chamber, is positioned at one meter from the focal spot of the x-ray source. Figure 2 shows possible Attix chamber configuration for a measurement procedure.

## Ionization-chamber current-measurement techniques

### Data collection

Ionization currents in air-kerma-standardization measurements are produced by the irradiation of a gas in an ionization chamber. The ionization chamber may be a free-air chamber, such as one of the national standard chambers, or a cavity chamber, where the gas is surrounded by some wall material. Ionization chambers, regardless of type, consist of electrodes that are insulated from one another and that are polarized in order to collect charge produced in the gas. The ions produced in the air by the beam are swept from the chamber volume by the electric field between the electrodes. Included in the measurement of these currents are currents not produced by the

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	5 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

radiation of interest, but by background radiation and insulator leakage. The magnitude and sign of these extraneous currents must be determined and the measured current corrected for their effects in order to determine the true ionization current. The importance of the correction for background and leakage is, of course, relative to the magnitude of the ionization current, but good measurement technique requires, prior to attempting radiation measurements, that the background and leakage currents be determined. As a rule of thumb, and without taking special precautions, the leakage current for a good-quality ionization chamber should be less than 5 fA. The measurement of leakage currents will also include currents due to background radiation, so the environment and special circumstances must be considered in evaluating data. For example, if tests are made on a large-volume ionization chamber in a background environment found suitable for small-volume chambers, the extra sensitivity of the large chamber requires separate evaluation of the background environment. Keithley 617 and 6512 electrometers are used to measure the charge collected in the ionization chambers.

### X-ray calibration data-acquisition system

Data are acquired for x-ray standardization by measurement of all conditions relevant to establishing the x-ray air-kerma rate at a particular distance from the x-ray-tube target. The data acquired consists of data for the computation of ionization currents, parameter data, and measurement-system test and information data. Data used to determine the ionization currents includes the electrometer charge measurements, the atmospheric pressure and pertinent air temperatures, and the shutter-open time interval. The parameter data includes the x-ray tube current and potential, the x-ray tube target-to-reference-point distance, and the beam-defining filter thickness and the diaphragm diameters. Test data includes the measurements of the collection potentials on the standard free-air chamber, the monitor chamber, and the chamber being calibrated, if appropriate. All data is acquired through National Instrument's LabView interfacing. The required equipment is listed in Table 6 and Table 7.

### Equipment

The temperature probes, pressure transducers and electrometers are considered essential support equipment to allow routine calibrations of ionization chambers. The maintenance and calibration of this support equipment follows. The quality of the ionization chamber calibration is not monitored by the calibration of the support equipment but rather by the NIST artifact quality procedure. The quality check of the calibration of all customer ionization chambers is determined by the reproducibility of the calibration coefficients of the NIST test chamber. Therefore if a calibration coefficient does not reproduce, the performance and calibration of the support equipment would be investigated.

The temperature sensors in the 100 and 300 kV x-ray ranges are Hart Scientific platinum resistance thermometers used to measure room, free-air chamber, and monitor-air temperatures, except for the Lamperti chamber, which uses a contact thermistor. In the Mammography Facility the Hart 5613 platinum resistance thermometers and Hart 1502 digital thermometers are used for air-temperature measurements in the vicinity of the Attix free-air chamber, the monitor chamber

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	6 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

and the test chambers. The thermometer calibration correction is applied internally to the 1502 digital meters.

The atmospheric pressure for the 100 and 300 kV x-ray ranges is measured by the Setra digital barometer and powered by a NIST power supply serial no. 2561. The output voltage is calibrated for pressure measurements in units of millimeters of Hg. A conversion to the unit of pascal is applied in the calculation of the calibration factor. The equation used for computing the pressure is:

$$P(\text{mmHg}) = -3.483 + 94.336(\text{voltage})$$

In the mammography range, a Setra 370 barometer is interfaced through RS232 to the data - acquisition software. Any necessary correction is applied directly through software as part of the air-kerma calculation.

The low-energy Pantak generator was calibrated in December of 1997 and the high-energy Pantak in February of 1998, using a calibrated (Test No. 722/G44568) high-voltage divider (Seifert Voltage Divider SN 720479). The procedure for a voltage calibration requires the use of the calibrated voltage divider, a calibrated high-precision digital multimeter, and a 10, 000 ohm resistor. The setup for this is described in Data book 852, page 146, and the results are listed in Data book 955, page 28, and Data book 957, page 3. The Pantak high-resolution voltage display reading, corresponding to the calibrated tube voltage was also determined. Because the calibrations showed some dependence of the voltage on the tube current, the results are given as a function of current for each tube-voltage setting. These results will be verified upon the calibration of recently acquired new voltage dividers once they are return to the Ionizing Radiation Division from the NIST Electricity group who are calibrating the dividers. A check of the voltage calibration is required after any of the x-ray generators are changed due to maintenance or replacement.

All time signals are controlled by a National Instrument data-acquisition card, which contains two 24-bit, 20 MHZ counters/timers. The signal to the timers is a pulse produced by a photodiode when its light beam is interrupted by a flag on the shutter mechanism. Upon initiating the exposure, counting commences only on receipt of the photodiode pulse. At the end of the preset time interval, the shutter is caused to close but the clock continues to count until the edge of the shutter crosses the portal mid-point. The timing shutter operation in both the 100 kV and the 300 kV x-ray range has recently been modified to use air-cylinder-controlled solenoids. The 300 kV machine also has a safety shutter that opens before, and closes after, the timing shutter. The lead thickness in the timing shutter was minimized for mechanical purposes but is of sufficient thickness to prevent significant effects on instrument readings in the interval between operations of the two shutters.

The charge measurements are acquired through the use of Keithley 617, 617-HiQ and 6512 electrometers. The internal capacitors of the electrometers are calibrated upon introduction into the system and anytime the charge collection is suspect. Any necessary correction is applied as part of the air-kerma calculation. Five electrometers, three 6512 and two 617-HiQ, are maintained for use in the low- and high-energy ranges. Four electrometers are maintained in the mammography range, two standard-capacitance-range electrometers (20 nC), a 617 HIQ (20

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	7 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

$\mu\text{C}$ ), and a midrange 617 (200 nC). The HiQ is dedicated for use with the monitor chamber and the midrange 617 is used for collecting charge on the Attix chamber. The two 20 nC capacitance range electrometers are used for the customer chambers. The procedure of calibrating a NIST reference-class chamber with each customer chamber is a quality-assurance check that rules out electrometer malfunctions.

#### Support equipment calibrations

There are no specified intervals for the critical support equipment because the equipment is calibrated using the in house reference standards described below anytime there is a question of reproducibility of the NIST transfer ionization chamber. Since the QA procedure for all x-ray calibrations requires the calibration of a NIST ionization chamber, any change in the reproducibility above 0.3 % to 0.5%, depending on the chamber type, may require an investigation into the support equipment used for the calibration. If any of the critical support equipment is found to be out of calibration or damaged, it would be removed and its condition clearly marked. A calibrated, identical model replacement instrument would be used for calibrations to continue until the repair of the damaged equipment is completed. Any damage and repair to the critical support equipment should be recorded in the current databook for the calibration of support equipment, titled *Calibration of Auxillary Equipment* Number 914, located in B019. All calibration records for the critical support equipment are located in a file drawer in B033.

#### Capacitor calibrations

Periodically, since 1956, the reference capacitors are submitted to the NIST Electronics and Electrical Engineering Laboratory, Electricity Division for calibration. The capacitors range in capacitance from 100, 1000, 10 000 and 100 000 pF. Some typical long-term calibration results have an uncertainty stated by the Electricity Division of no more than  $\pm 0.05\%$ . The uncertainty is interpreted by the Electricity Division as equivalent to three standard deviations. Typical reproducibility for the last forty years is 0.02 %.

#### Temperature indicator calibrations

Two liquid-in-glass thermometer and various probe and meter combinations are periodically calibrated by the NIST Chemical Science and Technology Laboratory, Process Measurements Division. The Hart instruments are also directly calibrated, if required, by the NIST temperature group.

#### Pressure indicator calibrations

An aneroid barometer, Wallace and Tierman, Model FA 139, Serial Number XX11242, as well as various other laboratory reference barometers are periodically calibrated by the NIST Process Measurements Division. Calibrations of individual pressure indicators used at the various sources are made by placing the calibrated barometer alongside the instrument to be tested and connecting both to a variable-pressure device. The instrument readings are compared over a

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	8 of 60	Procedure03v200



Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

range of pressures that is somewhat larger than normally expected. Data is taken with increasing and with decreasing pressure. The comparisons are made directly or through voltage signals. A correction factor is obtained from this data for each pressure indicator. This calibration procedure is conducted periodically and checks are made when the pressure rises or falls to extremes.

## Procedures

### Administrative procedures

Customers request calibration service in a variety of ways. Typically a new or first-time customer will establish contact with the Radiation Interactions and Dosimetry Group by telephone, letter, email or fax requesting information regarding techniques offered, charges, backlog time, turnaround time, and shipping/mailling information. At this stage, there is generally an opportunity to discuss with the prospective customer appropriate qualities of radiation for the type of service being requested and methods of shipment to reduce the risk of damage. The customer is informed that a purchase order must be received at NIST before an official calibration is performed. The purchase order can be sent with the instrument to be calibrated or can be sent separately by fax, mail or e-mail. In addition to an authorization for payment, the purchase order should include a detailed description of the calibration request, including beam quality codes, instrument model and serial numbers, name and telephone number of a technical contact

Upon receipt of the purchase order, a checklist and a customer test folder is generated. A copy of the purchase order, the final copy of the calibration report, the calibration raw data and summary sheets and any documents of correspondence between the customer or the Office of Measurement Services, Calibration Program Office are maintained in the customer's calibration-report folder filed by the unique dosimetry group (DG) number. After copying the purchase order for the customer folder, the original purchase order, and a completed check list, see Table 8, should be sent to the group secretary. The secretary will contact the Calibration Services group and a test folder will be sent and will contain the original purchase order and appropriate forms. The test folder's unique number is used as one of the identifiers on the calibration report.

When instruments arrive for calibration, they are unpacked and inspected for damage. Special attention is given to the condition and type of connector. If an adaptor is sent with the chamber, this should be noted on the inventory list along with the description of the chamber. Shipping damage is reported to the NIST shipping department. When an instrument arrives in a state of disrepair that is obvious by visual inspection, the customer is notified and a decision is made whether to return the instrument to the customer or, if the repair is minor, have NIST personnel perform the repair. The instrument would be rejected if the window is obviously dented or punctured or if the chamber cable is damaged. If the shipping box is visually damaged this should be noted and the customer consulted.

After the instrument has been calibrated, the calibration report is generated. Templates, generated in Microsoft Word and Excel are available to simplify this procedure and to ensure

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	9 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

consistency in the reporting format. The reports are printed on official NIST letterhead. A sample report is found as Appendix 1.

The final copy of the calibration report is reviewed and initialed by the preparer and an additional reviewer and then given to the group leader for review. After the group leader approves and initials the report, it is sent to the Division Office for signature. Upon return, two copies are made. The original is mailed to the customer, one copy is filed in the customer DG folder, and one copy is added to the test folder. After all requested calibration work is completed, the fees are computed and NIST form 64 is generated using the ISSC database. Copies are filed in the test folder and the customer DG folder, and the original is sent to the Administrative Officer for the Radiation Interactions and Dosimetry Group. The test folder is then signed and returned to the calibration program. The DG customer folder is filed in room B033. Shipping request forms are prepared after the Division Chief signs off on a calibration report and returns it to the Group office. The instrument is packed either in its original container or in a more suitable one if necessary.

### X-ray calibrations

X-ray calibrations are performed using the substitution method: the standard is used to measure the air-kerma rate at a given point in space, then the instrument to be calibrated is placed at that point and exposed to the same calibrated x-ray source under the same conditions. The probe's response is normalized to 101.325 kPa (760 mmHg) pressure and 295.15 K (22°C) if the instrument is open to the atmosphere, which depends on the type of chamber.

### Environmental parameters

During all calibrations the laboratory temperature must be maintained between 22°C +/- 2°C and stable to +/- 0.1 °C for typical measurement sets of 10 minutes. If the temperature is not stable during a typical measurement set, calibrations should be postponed. The laboratory humidity should be maintained between 20 % to 50% relative humidity. Calibrations can be continued if the humidity falls out of this range. Since the pressure is monitored and the charge data is normalized to pressure it is good laboratory practice to postpone data collection and calibration work during sudden changes in pressure due to storms or weather fronts. If the pressure reading is stable during the calibration collection time, the measurements can continue. If the pressure reading changes by more than 0.02% during a typical measurement it is good practice to stop the calibration.

### Set-up procedure

Prior to calibration, the test chamber is first aligned in the x-ray beam. The cross-hair reticle of a telemicroscope is set to the defining plane of the appropriate free-air chamber prior to final alignment of the probe, see Figures 1 and 3. For the Wyckoff-Attix (50 kV to 300 kV) chamber, the defining plane is the white line on the aperture holder. For the Ritz (20 kV to 100 kV) chamber, the defining plane is exactly 15.00 mm beyond the white line on the aperture holder in the downstream direction from the x-ray source. For the Lamperti (10 kV to 20 kV) chamber,

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	10 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

the defining plane is exactly 20.00 mm downstream from the source from the scribed line on the plastic insert that fits into the removable shield and touches the front face of the aperture. For the Attix (10 kV to 50 kV) chamber, the defining plane is the scribed line in the brass aperture holder. The test chamber is placed in a holder and the laser beam is used to determine vertical and horizontal alignment. Adjustment of the test chamber position to the defining plane is accomplished by sighting through the telemicroscope that was previously aligned on the defining plane of the free-air chamber. Motorized slides are then used to adjust the test-chamber reference point to the standard defining plane. Control of the motorized slides is accomplished using a control box located in the vicinity of each telemicroscope. In general all chambers should be aligned to the center of the test-chamber volume, but this should be verified with the customer. Most chambers are mounted perpendicular to the beam axis. If the chamber has a window, then it should be mounted such that the window faces the x-ray source. If a chamber has a reference line, then it should be used for alignment purposes. An identification mark or serial number should be used to reference the rotation with respect to the x-ray source. The alignment conditions, orientation and rotation of the chamber should be recorded in the calibration report.

If the chamber diameter is larger than 10 cm, such as the Exradin A6 chamber, the exact chamber diameter must be measured using a micrometer. The radius should be calculated and added to the previously determined scale reading of the telemicroscope. The cross-hair reticle of the telemicroscope should be moved to this location and be used as the tangent alignment point of the large-diameter chamber. The measured diameter should be recorded for future use. A further consideration for x-ray calibrations is the choice of an appropriate beam size. For this purpose a parameter called the "beam size" is compared to the largest dimension of the active volume of the chamber. The general practice is to use a beam size that is only a few centimeters larger than the active-volume size so as to minimize irradiation of inappropriate volumes in the probe stem. For x-rays, as opposed to high-energy gamma-rays, this is of secondary importance because the chamber stem attenuates the radiation considerably. The beam size of the x-ray beams, for all beam-defining apertures for the vertical and horizontal beam position, has been determined using an Exradin A1 ion chamber, as well as film. The useful beam size is the point where the ratio of the optical density to the center of the film reveals a change of less than 0.5 percent. The ratio of the intensity as measured with the ion chamber of the center to the outer point of the useful beam should also change less than 0.5 percent. Table 9 lists all the possible beam sizes for each calibration range.

After a pre-irradiation, leakage measurements are taken prior to calibration. If the leakage is a significant fraction of the expected exposure reading, either the probe is cleaned or is not calibrated. In addition, leakage measurements are made at the time of calibration. Again, if the leakage is found to be a significant fraction of the expected reading, the insulators are cleaned using canned dry gas. Because the gas is cold due to expansion, some time must be allowed for the chamber to equilibrate with room temperature. If the cleaning procedure is not successful, the calibration is terminated.

After mounting and aligning the chamber in the holder and applying the appropriate collection potential requested by the customer, the collecting voltage is checked at the chamber. This insures that the voltage connection has been made. Certain triax-to-BNC adapters can

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	11 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

accidentally ground and a short-circuit occurs if the triaxial portion of the adapter, which is held at high voltage is not insulated, see Figure 4. It is good practice to insulate this adapter and secure it in place so that movement of the instrument does not cause the cable to move. It is also important to keep all connections out of the radiation beam.

For all customer calibrations, a NIST reference-class transfer ionization chamber is calibrated for quality assurance. Some typical chambers are shown in Figure 4. Generally the NIST chamber selected is similar in design or collection volume to the customer chamber being calibrated. A NIST chamber is selected which has a previous calibration history to the reference radiation qualities which were selected by the customer. It is customary for the NIST chamber to be mounted in the holder closest to the NIST primary standard. The NIST reference-class chamber is aligned the same way as described previously for the customer test chamber.

#### Procedures for the calibration of chambers and collection of data

The following procedures are listed in numerical order. The actual order in which the steps are completed is required only where noted.

#### 100 kV or 300 kV x-ray calibration range

1. Turn on main power. The 100 kV main power is located on wall behind main computer control console. The 300 kV main power is located on the wall in the 300 kV range.
2. Turn on water supply and return. Failure to turn on water will result in an interlock error.
3. Turn on power to motor drives mounted in each range, see Figure 5.
4. Warm-up x-ray tube of choice.
  - a. turn on Pantak unit with key to position three, see Figure 6.
  - b. press blue “enter” key on the Pantak PMC controller and follow directions on digital entry pad
  - c. press green “start” key to begin preprogrammed warm-up, which takes about 20 minutes
  - d. if the unit has not been warmed-up for two weeks, follow dire manual warm-up
5. After the completion of the warm-up, to activate the remote mode on the Pantak PMC controller turn the Pantak key off and then back on to position three
  - a. after the “testing please wait” message press the blue “escape” key
  - b. at the “enter password” prompt, enter 7318 and press “enter”
  - c. press “enter” to continue until the prompt asks if remote control is desired
  - d. press “prog” as directed by the prompt to set unit in the remote mode
  - e. press enter as directed and eventually “escape” to leave the setup mode
  - f. the display should read “remote mode active”
6. Turn on the computer. The power on the Hopewell Design Inc. (HDI) controller, see Figure 7, must be off prior to putting power on the computer, and the power to the HDI controller must be

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	12 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

off prior to shut down of the computer. The correct x-ray range must be selected and all connections made for that range.

7. Turn on the HDI controller using the key on the front panel

8. Data entry in Access

a. start Access and use C:\100-300 XRay Sys\100300 NIST Track Rev7.2

b. select forms

c. select switchboard

d. enter appropriate data under the customer, instrument and workorder forms

9. Start the HDI Labview software using the provided shortcut for Rev8a.vi

a. login by entering operators initials (CMO) and the configuration code (456)

b. select the range to use. The default is the 300 kV range; for the 100 kV range click on the pink “300 x-ray system” selector key in the upper right of the front panel HDI software to toggle to the blue 100 kV system

c. home everything. For the 300 kV range select only the device under test (DUT) first and then each of the other options individually upon the completion of motion of the previous. All options can be selected and homed simultaneously for the 100 kV range.

10. Secure chamber cart in the desired position

11. Mount chambers as described previously using the laser and telescope. Connect signal and high-voltage cables, see Figure 4. Toggle between chambers using the front control panel; press actuate to move the chambers.

12. Verify that the correct filter wheel is mounted; if not then repeat the homing procedure of the filter wheel and verify that the filter corresponds to the selection

13. Verify that the correct cables are connected on the front control panel for the chamber signals and high-voltage and that all support equipment to be used is energized, see Figures 7, 8 and 9.

14. All address for the IEEE equipment should never be changed, but if necessary verification of the appropriate address can be made. All addresses are on labels on the control panel.

15. Once the chambers are positioned and secured, apply high voltage. Enter the desired high voltage on the front panel display of the HDI software and flip the Bertan HV switch on. The voltage is maintained on the primary standards, but make a visual check that voltage is set, see Figure 8.

16. Close doors to ranges, so the safety interlocks will allow the use of the x-ray beam.

17. Verify that the HDI software is communicating with the Pantak controller

a. select computer mode on front panel

b. enter kV and mA

c. turn on HV control toggle

d. select a beam code to initiate response with controller

e. check leakage on chamber

18. Verify the collection time, so as to not overload the electrometers. This depends on the air-kerma rate for the beam quality. Put each chamber in the beam using the conditions for the calibration and establish the collection time. Press the “exposure enable” at the bottom of the screen so it is not red. Secure the interlocks for entrance to the rooms. Press the red “open” button on the HDI control panel to open the shutter. The time of the exposure will accumulate on the front panel of the HDI software.

19. Press “build sequence” to prepare an automated test sequence.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	13 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

20. Enter the workorder number of the previously entered data in Access. When the “get workorder” button is selected, the background information for the customer chamber automatically is entered. The toggle switch for the customer chamber position (T1 or T2) must correspond with the correct position.
21. Create a unique cal run ID.
22. Enter the pressure, temperature and humidity from the front-panel displays.
23. Enter the beam aperture selected and the diameter of the beam and the distance of the calibration.
24. Enter the identification information of the NIST reference-class chamber to be calibrated.
25. Enter in the desired collection times and the number of measurements to be collected.
26. Finally select the beam codes, enter the currents and select the ISO A1 filter if appropriate.
27. Upon completion press “build sequence”.
28. At the front panel press “start auto sequence” to begin the calibration.
29. Upon completion of the calibration, review the data from the printed reports. If some data needs to be eliminated go to Access.
  - a. open the “exphist” table and find the data points to delete. Place a check in the appropriate column to delete the data point.
  - b. on the front panel of the HDI software select “Redo Report”. Enter the work order number and the unique cal run ID. Press “get records”. Select the appropriate beam code. Repeat until all data is recalculated.
30. A summary of the final data for both chambers is stored to an Access file named InstCalReport. Select the records desired and copy to excel spreadsheet to complete summary calculations. The spreadsheet should be named by the DG number and stored in the following locations as described below.
31. Repeat steps 28 through 30 until a sufficient number of calibrations have been completed for each beam quality.
32. The expected standard deviation on the calibration results depends on the chamber type; but generally a standard deviation near 0.1% is acceptable.
33. The averages of multiple calibrations are maintained in the Excel spreadsheets. These Excel files are named by the DG number and saved as described in the electronic-data section of this manual.
34. The data is also recorded on index card forms that have been maintained for many years for all previously calibrated chambers. The current calibration results are compared with previous results. This verifies the quality of the calibration.
35. The summary data is then pasted into the Word or Excel templates for the calibration report. A sample report follows as Attachment 1.

#### Mammography x-ray calibration range

1. Turn on main power which is on the wall inside the calibration facility. The water cooler will automatically be energized.
2. Turn on water supply and return. Failure to turn on water will result in an interlock error.
3. Turn on power to motor drives mounted on back of tube stand. This power generally resides energized.
4. Verify that Velmex controller, which is under the primary standard, is energized.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	14 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

5. Energize alignment laser, located in back of range.
6. Verify the primary standard cart is secured at 1 m and that the Attix chamber's moveable alignment slide is in the position furthest from the source, see Figure 10.
7. First verify that the HDI controller key switch is off then energize the computer, see Figure 11.
8. Turn key to the third position on MP1 x-ray controller.
9. Turn key switch to "on" at the HDI controller.
10. Select x-ray tube by key located above the MP1 controller.
11. Verify that power is on all instruments visible from control area. These include four Keithley electrometers, four Bertan high-voltage supplies, three Hart thermometers and a Setra barometer. The front panels of these instruments should be illuminated, see Figure 12.
12. Start the HDI Labview software using the provided shortcut for Rev8a.vi
  - a. login by entering operators initials (CMO) and the configuration code (456)
  - b. home all instruments
  - c. select the appropriate tube, close the tube shield, and then select actuate to position the tube
  - c. home the Velmex controller by selecting the "home" button by the FAC position selectors
13. With the shielding-door closed, (so the interlocks are connected), perform a test of the shutter. With the expose enable off, press the open button on the HDI controller. Press the close button to close the shutter. This test must occur prior to the first automated calibration to ensure proper performance of the shutter.
14. Warm-up the x-ray tube. The MP1 controller must be in mode 101 to warm it up. For complete details see the MP1 manuals. Once the 20 minute warm-up is complete, select the 800 remote operating mode.
15. Verify that computer communication has been made with the x-ray controller by selecting a different beam code. Verify the kV changes on the display window.
16. Mount chambers using the laser and telescope starting with the Attix chamber and then follow with chamber T2 and T1. Connect signal and high-voltage cables. Toggle between chambers using the front control panel: press actuate to move the chambers.
17. All addresses for the IEEE equipment should never be changed, but if necessary verification of the appropriate address can be made. All addresses are on labels on the control panel.
18. Once the chambers are positioned and secured, apply high voltage. Enter the desired high voltage on the front panel display of the HDI software and flip the Bertan HV switch on. The voltage is maintained on the primary standards, but make a visual check that voltage is set.
19. Close door to range, so the safety interlocks will allow the opening of the x-ray shutter.
20. Data entry in Access
  - a. start Access and using the shortcut on desktop for Mamsys NIST Track Rev7.2
  - b. select forms
  - c. select switchboard
  - d. enter appropriate data under the customer, instrument and work order forms
21. Verify the collection time, so as to not overload the electrometers. This depends on the air-kerma rate for the beam quality. Put each chamber in the beam using the conditions for the calibration and establish the collection time. Press the "exposure enable" at the bottom of the screen so it is not red. Secure the interlocks for entrance to the rooms. Press the red "open"

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	15 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

button on the HDI control panel to open the shutter. The time of the exposure will accumulate on the front panel of the HDI software.

22. Press “build sequence” to prepare an automated test sequence.
23. Enter the workorder number of the previously entered data in Access. When the “get workorder” button is selected, the background information for the customer chamber automatically is entered. The toggle switch for the customer chamber position ( T1 or T2) must correspond with the correct position.
24. Create a unique cal run ID.
25. Enter the pressure, temperature and humidity from the front-panel displays.
26. Enter the beam aperture selected and the diameter of the beam and the distance of the calibration.
27. Enter the identification information of the NIST reference-class chamber to be calibrated.
28. Enter in the desired collection times and the number of measurements to be collected.
29. Finally select the beam codes.
30. Upon completion press “build sequence”.
31. At the front panel press “start auto sequence” to begin the calibration.
32. Upon completion of the calibration, review the data from the printed reports. If some data needs to be eliminated, go to Access.
  - a. Open the “exphist” table and find the data points to delete. Place a check in the appropriate column to delete the data point.
  - b. On the front panel of the HDI software select “Redo Report”. Enter the work order number and the unique cal run ID. Press “get records”. Select the appropriate beam code. Repeat until all data is recalculated.
33. A summary of the final data for both chambers is stored to an Access file named InstCalReport. Select the records desired and copy to Excel spreadsheet to complete summary calculations. The spreadsheet should be named by the DG number and stored as described below.
34. Repeat steps 30 through 33 until a sufficient number of calibrations have been completed for each beam quality.
35. The expected standard deviation on the calibration results depends on the chamber type but generally a standard deviation less than 0.5% is acceptable.
36. The averages of multiple calibrations are maintained in the Excel spreadsheets. These Excel files are named by the DG number and saved as described in the electronic-data section of this manual.
37. The data is also recorded on index card forms that have been maintained for many years for all previously calibrated chambers. The current calibration results are compared with previous results. This verifies the quality of the calibration.
38. The summary data is then pasted into the Word or Excel templates for the calibration report. A sample report follows in Attachment 1.

#### Electronic data

All data collected with the NIST reference-class chambers is saved in the appropriate files located at the following location <\\Ridserver\\RIDshare\\OBrien\\chamberhistory>. The folder to be

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	16 of 60	Procedure03v200



Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

used is either NISTREFSTD or NISTREFSTDMAMMO depending on which type chamber is used. The files are organized and named by model and serial number. Similarly the data collected using the customer chamber is saved in the following location

<\\Ridserver\\RIDshare\\OBrien\\chamberhistory\\customerdata>. The final reports are saved to the following location: <\\Ridserver\\RIDshare\\OBrien\\calibrationreports\\customer>.

#### In-house calibration checks

The long-term reliability of NIST dosimetry calibrations depends on the stability of the NIST air-kerma standards. For x-rays, the NIST air-kerma standard is the response of the appropriate free-air chamber. The four free-air chambers are also periodically compared. The in-house calibration checks are intended to check both the stability of the NIST standards and the reliability of the calibration procedures. Comparison results are listed in Ref. 6.

Two methods are used to verify a calibration. The first is to calibrate a NIST chamber that has a calibration history and is similar to the customer's chamber as described previously. The second check is an examination of previous calibrations of the customer's instrument at the same beam quality. If the discrepancy is significant, greater than 0.5% but dependent on the chamber type, an investigation is warranted. If there are several previous calibrations of the customer's instrument at any one beam quality, one can estimate the reproducibility and decide whether the current value is acceptable.

For all NIST reference-class chambers, a record is maintained of all calibrations, and the previous calibrations are compared with the current calibration to detect any trend or measurement discrepancy. In recent years all data collected with the NIST reference-class chambers have been saved in the appropriate files located at the following location <\\Ridserver\\RIDshare\\OBrien\\chamberhistory>. The folder to be used is either NISTREFSTD or NISTREFSTDMAMMO depending on which type chamber is used. The files are organized and named by model and serial number. The calibration history for many NIST reference chambers obtained prior to 1999 is maintained in binders located in room B019. Any discrepancy found for a NIST check chamber of the order of magnitude mentioned above, gives rise to a thorough investigation of the calibration procedure. Alignment, temperature indications, distance, etc., are to be checked again. If the discrepancy cannot be resolved, the complete calibration process is repeated.

#### Test of high-quality electrometers

NIST provides a test service (46030S) for high-quality feedback electrometers that are used in conjunction with current-type ionization chambers also being calibrated at NIST. The procedure involves electrically testing the electrometer using one feedback-capacitor and computing a calibration factor,  $K_Q$ . A typical report form is found in Attachment 2. As a check on this electrical test, the customer's current-type chamber is calibrated for one beam quality with both the NIST system and with the customer's system. Agreement is usually within 0.2 %, if not, the calibration is reviewed and possibly repeated.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	17 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

## Procedure for test of high-quality feedback electrometers

1. This procedure describes the calibration of a Keithley 617 electrometer, but may be applied to other electrometers if proper adjustments are made to setup and operational parameters.
2. Required equipment located in B033
  - a. Fluke model 343A DC voltage calibrator
  - b. 1000 pF +/- 0.1% standard air capacitor
  - c. Low-noise coaxial BNC cable
  - d. Keithley 6147 coaxial/triaxial adapter
3. Ensure that the voltage calibrator has been calibrated recently with the calibrated Hewlett Packard digital voltmeter model 3456A.
4. Connect the voltage source to the capacitor using the coaxial cable as shown Figure 13.
5. A Keithley 6147 adapter is required on the input BNC on the back of the electrometer.
6. Connect the capacitor to the 6147 on the electrometer using the low noise cable.
7. Apply power to the electrometer. The electrometer should have power on it for at least two hours prior to use.
8. Turn on the voltage source, which should be on for about 30 minutes prior to performing a calibration.
9. Set the zero check on the electrometer to ON.
10. Set the range setting to the setting most likely used during normal operation and record this setting.
11. Set the electrometer to the Coulombs mode.
12. Turn the V, $\Omega$  guard switch on the back of the electrometer to the OFF position for this charge calibration.
13. Turn the zero check OFF and record the initial reading.
14. Apply the desired reading and record this final reading.
15. Turn the zero check ON and adjust the voltage source to 0.
16. Repeat the above procedure using both polarities until the desired amount of data is collected.
  - a. Take the appropriate number of measurements for each setting depending on the stability of the readings.
  - b. To change the polarity, reverse the connectors to the voltage source.
17. Multiply the voltage setting by the capacitance charge to obtain the standard charge. If a voltage-source correction factor is available, multiply this by the standard charge.
18. Subtract the initial reading from the final reading to obtain the net charge.
19. Average the net charges if more than one reading was collected for a given voltage.
20. Calculate the calibration factor (KQ) by dividing the standard charge by the net charge.
- 21 Prepare a report similar to the template shown in this document as Attachment 2.
22. Include the test results in data book 901 or the appropriate laboratory book.

## Uncertainty Analysis

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	18 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

The method of uncertainty assessment follows the NIST policy of expressing uncertainty, as outlined in the NIST Technical Note 1297. Conventional statistical estimates are given as standard deviations of the mean, and are designated as “Type A”, which can be considered to be objective estimates. All other uncertainty estimates, which are designated “Type B”, are subjective estimates, based on extensive experience. The “Type B” uncertainties are estimated so as to correspond approximately to one standard deviation. The Type A and Type B estimates are combined according to the usual rule for combining standard deviations, by taking the square root of the sum of the squares, the quadratic sum. The quadratic sum of the two types of uncertainty is then considered to be the combined uncertainty, which is in turn multiplied by the coverage factor, of two, to give the expanded uncertainty. This expanded uncertainty is considered to have the approximate significance of a 95 % confidence limit. Table 10 lists the details of the assessment of uncertainty for the air kerma rates determined for the tungsten x-ray beams by the free-air ionization chambers. Table 11 lists the details of the assessment of uncertainty in the calibration of a typical ionization chamber. Table 12 lists the details of the assessment of uncertainty in air-kerma rates determined for the mammography x-ray beams by the Attix chamber. Table 13 lists the uncertainty components for the calibration of instruments used for mammography. As the estimates of uncertainty varies lightly with beam qualities, methods of measurement, and rate, in each case the largest value is used for the estimate. In an official calibration, measurements could be repeated to maintain optimal conditions

## Safety

The main safety consideration is radiation protection. As described below, every effort is made to avoid any possibility of radiation exposure, even though it would be highly unlikely that serious exposures could occur accidentally. Another safety consideration is exposure to high voltage, such as exists on ionization chambers and standard chambers during calibration. There is no danger of high voltage related to the x-ray generators because the equipment now in use has no exposed high voltage in a normal operating mode. All radiation areas in the building are marked with striped tape and dosimeters must be worn by all personnel.

### Radiation safety

### X-ray calibration ranges

First and foremost, the three x-ray source ranges are designed to eliminate any possible exposure to x radiation. The 100 kV x-ray tube is interlocked with its power supply in such a way that if the tube is moved from a safe position, i.e., away from a lead shutter, the high voltage is turned off. Recent changes to the shielding of this tube eliminated the leakage radiation that once occurred between the shutter assembly and the tube window at 90°. Flashing red lights signal any malfunction to the shutter, and an audible area radiation detector has been recently implemented as a back-up precaution. The 300 kV x-ray tube is enclosed in a housing of 19 mm Pb and 6.4 mm steel. There is a 25 mm lead safety shutter and a 12.7 mm lead timing shutter in front of the beam portal. Both x-ray calibration ranges are protected by lead-lined doors that are interlocked in a fail-safe manner with the shutters. This means that the shutter or shutters cannot

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	19 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

be opened if the door interlock is open. Where no door exits, as in one area of the 300 kV x-ray range, a light beam is used for protection. In addition, a time-delay device inside the 300 kV x-ray range must be actuated upon leaving or the shutter cannot be opened. As a further indication of radiation danger, two red lights are turned on whenever the shutter or shutters are open. A flashing red light associated with the 300 kV x-ray set indicates high voltage is on the x-ray tube. The mammography-range shielding door is interlocked with the x-ray tube shutter. If the door is opened or is not fully closed, the shutter will return to the shielded position. An audible alarm will sound if the shutter is not fully closed. Red lights illuminate when the shutter is opened. Additional lead shielding surrounds the x-ray tube, which must be in the shielding position for power to be applied to the x-ray tube. No area radiation monitor is used due to the extremely narrow beam and the low-scatter conditions resulting from the low-energy x rays used in the mammography range.

### High-voltage safety

The only danger that exists from high voltage comes from the free-air ionization chambers, the customer chamber, and the x-ray-calibration-range monitor chambers. To prevent dangerous electric shock, almost all power supplies contain current-limiting resistors in the high-voltage circuit. Common sense is dictated when working around ionization chambers that have exposed high-voltage electrodes. Appropriate warning signs are posted. The risk of high voltage from the Attix chamber is minimized by surrounding the chamber with its protective cover.

### Filing and Retention

The IRD Quality Manager shall maintain the original and all past versions of this IRD Procedure. Copies of the current revision of this Procedure shall be placed in controlled Quality Manuals. Electronic copies of this Procedure are uncontrolled versions.

All deleted Procedures (including old revisions) shall be maintained by the IRD Quality Manager. All old revisions shall be maintained until such time as it is decided to delete the Procedure. Once the decision has been made to delete the Procedure, only the last revision shall be maintained by the IRD Quality Manager.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	20 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

Table 1. NIST Calibration Conditions for X- Ray Measuring Instruments

Beam code	Additional Filtration <sup>a</sup>				Half-value layer <sup>b</sup> (HVL)		Homogeneity coefficient (HC)		Effective energy (keV)
	Al (mm)	Cu (mm)	Sn (mm)	Pb (mm)	Al (mm)	Cu (mm)	Al	Cu	
X-Ray Beam Qualities									
L10					0.037		86		
L15					0.059		70		
L20					0.070		72		
L30	0.30				0.23		60		
L40	0.53				0.52		61		
L50	0.71				0.79		63		
L80	1.45				1.81		56		
L100	1.98				2.80		58		
M20	0.27				0.15		72		
M30	0.5				0.36		65		
M40	0.89				0.74		67		
M50	1.07				1.04		68		
M60	1.81				1.64	0.052	63	60	
M80	2.86				2.98	0.10	68	61	
M100	5.25				5.00	0.20	74	55	
M120	7.12				6.72	0.31	77	53	
M150	5.25	0.25			10.1	0.66	88	63	
M200	4.35	1.12			14.7	1.64	94	68	
M250	5.25	3.2			18.3	3.2	98	85	
M300	4.25		6.5		21.7	5.3	100	97	
H10	0.105				0.051		77		
H15	0.5				0.16		87		
H20	1.01				0.36		89		
H30	4.50				1.20		86		
H40	4.53	0.26			2.93		94		
H50	4.0			0.1	4.2	0.14	93	93	38
H60	4.0	0.61			6.0	0.25	94	94	46
H100	4.0	5.2			13.4	1.15	97	92	80
H150	4.0	4.0	1.51		16.9	2.43	100	96	120
H200	4.0	0.6	4.16	0.77	19.7	4.10	99	99	166
H250	4.0	0.6	1.04	2.72	22	5.19	99	98	211
H300	4.1		3.0	5.0	23	6.19	99	98	252
S60	4.35				2.79	0.09	76	66	
S75	1.50				1.81		58		

<sup>a</sup>The additional filtration value does not include the inherent filtration. The inherent filtration is approximately 1.0 mm Be for beam codes L10-L100, M20-M50, H10-H40 and S75; and 3.0 mm Be for beam codes M60-M300, H50-H300 and S60. <sup>b</sup>The HVL values were measured directly using the two new x-ray tubes installed in November of 2001 and May of 2002.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	21 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

Table 2. Mammography X-Ray Beam Quality Parameters

NIST Beam Code	Tube Voltage <sup>1</sup> (kVp)	Added Filter <sup>2</sup> (mm)	Half-Value Layer (mm Al)	Homogeneity Coefficient (Al)
Mo Anode <sup>3</sup>				
Mo/Mo23	23	0.032 Mo	0.271	0.702
Mo/Mo25	25	0.032 Mo	0.296	0.719
Mo/Mo28	28	0.032 Mo	0.332	0.743
Mo/Mo30	30	0.032 Mo	0.351	0.752
Mo/Mo35	35	0.032 Mo	0.392	0.784
Mo/Rh28	28	0.029 Rh	0.408	0.796
Mo/Rh32	32	0.029 Rh	0.445	0.821
Mo/Mo25x	25	0.030 Mo + 2.0 Al	0.566	0.91
Mo/Mo28x	28	0.030 Mo + 2.0 Al	0.626	0.964
Mo/Mo30x	30	0.030 Mo + 2.0 Al	0.660	0.947
Mo/Mo35x	35	0.030 Mo + 2.0 Al	0.748	0.902
Rh Anode				
Rh/Rh25	25	0.029 Rh	0.351	0.755
Rh/Rh30	30	0.029 Rh	0.438	0.812
Rh/Rh35	35	0.029 Rh	0.512	0.858
Rh/Rh40	40	0.029 Rh	0.559	0.895
Rh/Rh30x	30	0.029 Rh + 2.0 Al	0.814	0.964
Rh/Rh35x	35	0.029 Rh + 2.0 Al	0.898	0.945

<sup>1</sup>Typical air-kerma rates range between 0.2 and 2 mGy/s, except for exit beams with tube voltages of 30 kVp or less, where the rates do not exceed 0.1 mGy/s.

<sup>2</sup>The inherent filtration is comprised of 1.0 mm Be from the x-ray tube window and 0.075 mm polyamid from the transmission monitor.

<sup>3</sup>Reference beam qualities generated by the molybdenum anode with a nominal focal spot size of 5 x 5 mm.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	22 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

Table 3. ISO X-Ray Beam Quality Parameters Offered at NIST

Beam Code	Additional Filtration (mm) <sup>a</sup>				First HVL <sup>b</sup>		Second HVL <sup>b</sup>	
	Al	Cu	Sn	Pb	mmAl	mmCu	mmAl	mmCu
HK10					0.042		0.045	
HK20	0.15				0.128		0.170	
HK30	0.52				0.408		0.596	
HK60	3.19					0.079		0.113
HK100	3.90	0.15				0.298		0.463
HK200		1.15				1.669		2.447
HK250		1.60				2.463		3.37
HK280		3.06				3.493		4.089
HK300		2.51				3.474		4.205
WS60		0.3				0.179		0.206
WS80 <sup>c</sup>		0.529				0.337		0.44
WS110 <sup>c</sup>		2.029				0.97		1.13
WS150 <sup>c</sup>			1.03			1.88		2.13
WS200 <sup>c</sup>			2.01			3.09		3.35
WS250 <sup>c</sup>			4.01			4.30		4.50
WS300 <sup>c</sup>			6.54			5.23		5.38
NS10	0.095				0.049		0.061	
NS15	0.49				0.153		0.167	
NS20	0.90				0.324		0.351	
NS25	2.04				0.691		0.762	
NS30	4.02				1.154		1.396	
NS40		0.21				0.082		0.094
NS60		0.6				0.241		0.271
NS80 <sup>c</sup>		2.0				0.59		0.62
NS100		5.0				1.14		1.24
NS120		4.99	1.04			1.76		1.84
NS150			2.50			2.41		2.57
NS200 <sup>c</sup>		2.04	2.98			4.09		4.20
NS250			2.01	2.97		5.34		5.40
NS300 <sup>c</sup>			2.99	4.99		6.17		6.30
LK10	0.30				0.061			
LK20	2.04				0.441			
LK30	3.98	0.18			1.492			
LK35		0.25			2.21			
LK55		1.19				0.260		
LK70 <sup>d</sup>		2.64				0.509		
LK100 <sup>d</sup>		0.52	2.0			1.27		
LK125		1.0	4.0			2.107		2.094
LK170		1.0	3.0	1.5		3.565		3.592
LK210		0.5	2.0	3.5		4.726		4.733
LK240		0.5	2.0	5.5		5.515		5.542

<sup>a</sup> The additional filtration does not include the inherent filtration. The inherent filtration is a combination of the filtration due to the monitor chamber plus 1 mm Be for beam codes LK10-LK30, NS10-NS30, HK10-HK30; for all other techniques the inherent filtration is adjusted to 4 mm Al. <sup>b</sup> The HVL values were measured directly using the two new x-ray tubes installed in November of 2001 and May of 2002. <sup>c</sup> Previous HVL values; need to be measured on the new MXR-321 tube. <sup>d</sup> Might be redeveloped using the Wyckoff-Attix rather than the Ritz FAC.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	23 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

Table 4. Important dimensions and parameters for the use of the NIST standard free-air ionization chambers

Chamber	X-ray tube potential (kV)	Alignment offset <sup>a</sup>	Operating potential (v)	Diaphragm diameter/ID (mm)	Air absorption length (mm)
Lamperti	10 - 60	20 mm	1500	4.994/5s	39.18
Attix	10 - 50	None	2500	10.00/10u	212.7 <sup>b</sup>
Ritz	20 - 100	15 mm	5000	10.00/10A	127.39
Wyckoff - Attix	50 - 300	None	5000	10.00/10B	308

<sup>a</sup>.The distance down-stream from the chamber aperture to move the alignment telescope to properly align the chamber.

<sup>b</sup> This is variable; the value shown is that used for routine use.

Table 5. Features of X-ray Systems

Features	Unipolar <sup>a</sup>	Bipolar <sup>b</sup>	Mammography <sup>c</sup>
Manufacturer	Pantak	Pantak	Gulmay
Output voltage (kV)	5 to 100	5 to 320	5 to 50
Output current (mA)	0.5 to 80	0.5 to 30	0.1 to 40
Output power (kW)	up to 3.2	up to 4.2	up to 1.2
kV adjustment (kV)	0.1	0.1	0.1
mA adjustment (mA)	0.01	0.01	0.1
Fixed anode material	W	W	Mo and Rh <sup>d</sup>
Tube window (mm Be)	1	3	1
Focal spot size (mm)	3 x 3	4 x 4	4 x 4 and 5 x 5

<sup>a</sup> The generator was installed in December 1997 and the tube was replaced in November 2001.

<sup>b</sup> The generator was installed in February 1998 and the tube replaced in May 2002.

<sup>c</sup> The generator and tubes were installed in 1994.

<sup>d</sup> Two x-ray tubes are used in the mammography calibration range with the same generator.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	24 of 60	Procedure03v200



Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

Table 6. Essential equipment to conduct calibrations in the 100 kV and 300 kV range

Description	Model	Serial number
Pantak voltage divider	ZD76390	0108-6912
Pantak voltage divider	ZD76390	0210-9603
HP high-precision digital voltmeter	3456A	2512A
Fluke high-voltage power supply	410B	2430011
Setra barometer	350-1	340176
Wallace-Tiernan barometer	FA139	MM14869
Bertan high-voltage power supply	Series230	9186
Bertan high-voltage power supply	Series 225	7192
Bertan high-voltage power supply	Series 225	7262
Keithley electrometer	6517 Hi-Q	0646383
Keithley electrometer	6512	0664956
Keithley electrometer	6512	0664959
Keithley electrometer	6512	0664959
Hart thermometer Chub-E4	1529	A1B165
Hart thermometer	1504	9A183
Hopewell Designs Inc.controller		
Pantak PMC 1000 high-resolution controller	HF100	97102875CP
Pantak PMC 1000 high-resolution controller	HF 320	98013051CP
Pantak water cooler	HF100	97102875WC
Pantak water cooler	HF320	96041605OCW

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	25 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

Table 7. Essential equipment to conduct calibrations in the mammography calibration range

Description	Model	Serial number
Hart thermometer	1502	44122
Hart thermometer	1502	46138
Hart thermometer	1502	62495
Keithley electrometer	617 HiQ	nist564062
Keithley electrometer	617-midrange	nist564064
Keithley electrometer	617	0566314
Keithley electrometer	617	388587
Setra barometer	370	498554
Bertan high-voltage power supply	Series225	7191
Bertan high-voltage power supply	Series 225	6252
Bertan high-voltage power supply	Series 225	4183
Bertan high-voltage power supply	Series 225	4172
Velmex controller	NF90	0994301
MP1 x-ray controller	CP62	
Hopewell Designs Inc. controller		nist583270
Pantak water cooler		

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	26 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

Table 8. Example of checklist to be completed prior to requesting a test folder

<b>Test Folder Request Form</b>					
<b>Required Dates</b>			<b>Optional Dates</b>		
PO received			Estimated job start		
Estimated completion			Equipment arrival		
Report mailed			Inspection complete		
Equipment returned					
<b>Contact Information</b>					
NIST Technical Contact:					
Company:					
Technical Contact:					
DG Number:					
<b>Instrument Description</b>					
Manufacturer <b>Exradin</b>		Model		Serial Number	
<b>Calibration Request and Cost</b>					
SP 250 Cal ID <b>46010C</b>	Item Description <b>X-Ray Calibration</b>	Qty	Cost for this Cal ID		
SP 250 Cal ID <b>46011C</b>	Item Description <b>X-Ray Calibration</b>	Qty	Cost each Cal ID	Cost for this Cal D	
<b>Shipping Information</b>					
Is the preparation of a shipping order required?			<b>YES NO</b>		
Will the report be mailed with the instrument?			<b>YES NO</b>		
Shipping Address			Contents: <b>Ionization Chamber(s)</b>		Value:
			Model	SN	
Special shipping instruction: Please mark as delicate instrument. Please foam in place or use bubble wrap.					

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	27 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

Table 9. Beam sizes in the x-ray ranges using various beam-defining apertures and various distances

Distance from source (cm)	Beam defining aperture (cm)	Diameter at measurement point (cm)
300 kV X-Ray Range		
100	1.3	3
	1.6	4
	1.9	6
	2.5	9
	5.1	21
200	1.3	5
	1.6	8
	1.9	11
	2.5	17
	5.1	42
100 kV X-Ray Range		
50	1.3	5
	1.9	8
	2.5	11
100	1.3	10
	1.9	16
	2.5	22
Mammography X-Ray Range		
100	1.3	4
	2.5	9

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	28 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

Table 10. Typical uncertainty analysis for tungsten x-ray air-kerma rates, relative uncertainties shown in %.

Uncertainty components	X-ray beam	
	Type A	Type B
air density	0.01	0.08
charge	0.13	0.06
humidity		0.07
volume	0.04	0.01
g		0.02
W/e		0.15
air attenuation, $k_a$		0.02
electric-field distortion		0.2
electron loss, $k_e$		0.1
penetration of aperture		0.04
penetration of chamber face		0.01
polarity difference	0.1	
recombination loss, $k_s$	0.1	
fluorescence $k_{fl}$		0.3
scattered photons, $k_p$		0.07
quadratic sum	0.20	0.43
combined standard uncertainty	0.47	
expanded uncertainty	0.95	

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	29 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

Table 11. Uncertainty analysis for x-ray calibrations, shown in %

Uncertainty components	Type A	Type B
air kerma rate	0.20	0.43
air density	0.01	0.08
charge	0.12	0.06
distance	0.01	
humidity		0.07
radiation background	negligible	
quadratic sum	0.23	0.45
combined standard uncertainty		0.50
expanded uncertainty		1.00

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	30 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

Table 12. Uncertainty analysis for air-kerma rates with the Attix chamber, shown in %

Uncertainty components	Type A	Type B
air density	0.01	0.08
aperture area	0.01	0.01
charge	0.20	0.06
humidity		0.07
plate separation	0.01	0.07
air attenuation	0.20	0.01
g		0.02
photon scatter		0.20
polarity	0.1	
recombination	0.06	
W/e		0.15
quadratic sum	0.31	0.29
combined standard uncertainty	0.42	
expanded uncertainty	0.84	

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	31 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

Table 13. Uncertainty analysis for mammography calibrations, shown in %

Uncertainty components	Type A	Type B
Air kerma rate	0.31	0.29
charge	0.14	0.06
Air density	0.10	0.08
humidity		0.07
distance		0.02
quadratic sum	0.34	0.32
combined standard uncertainty		0.46
expanded uncertainty		0.92

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	32 of 60	Procedure03v200



Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

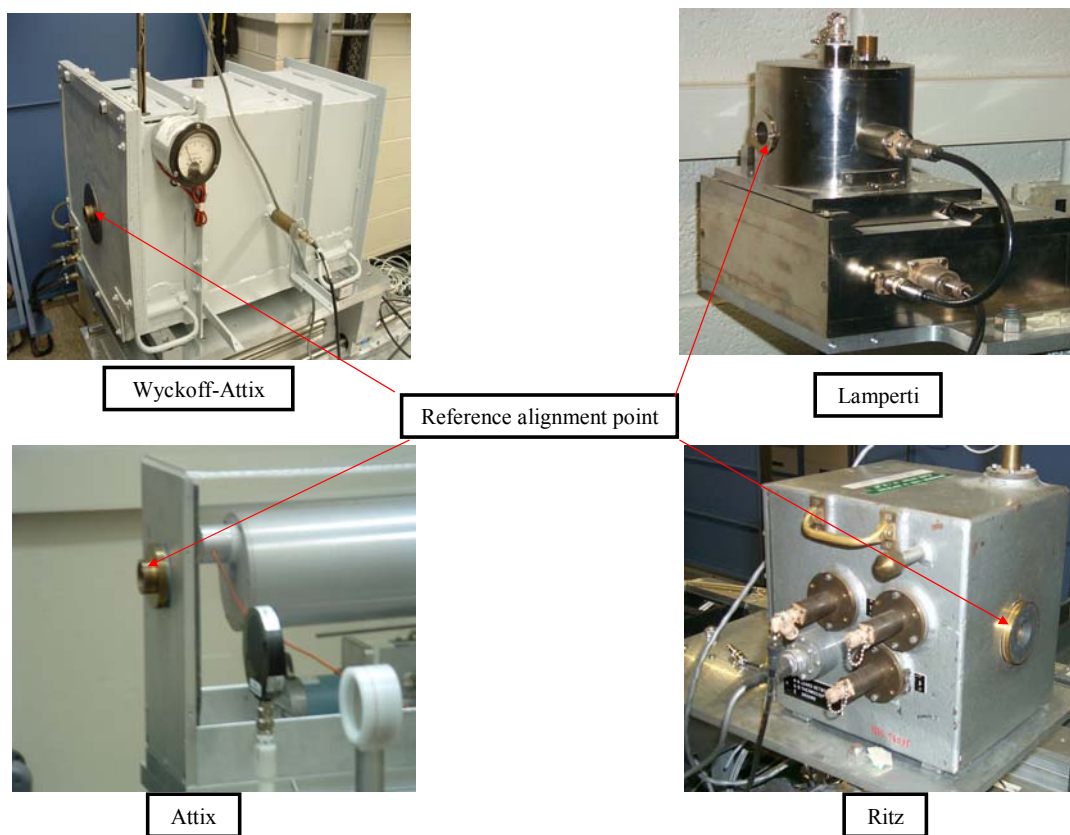


Figure 1. The four NIST x-ray standards showing the alignment points.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	33 of 60	Procedure03v200

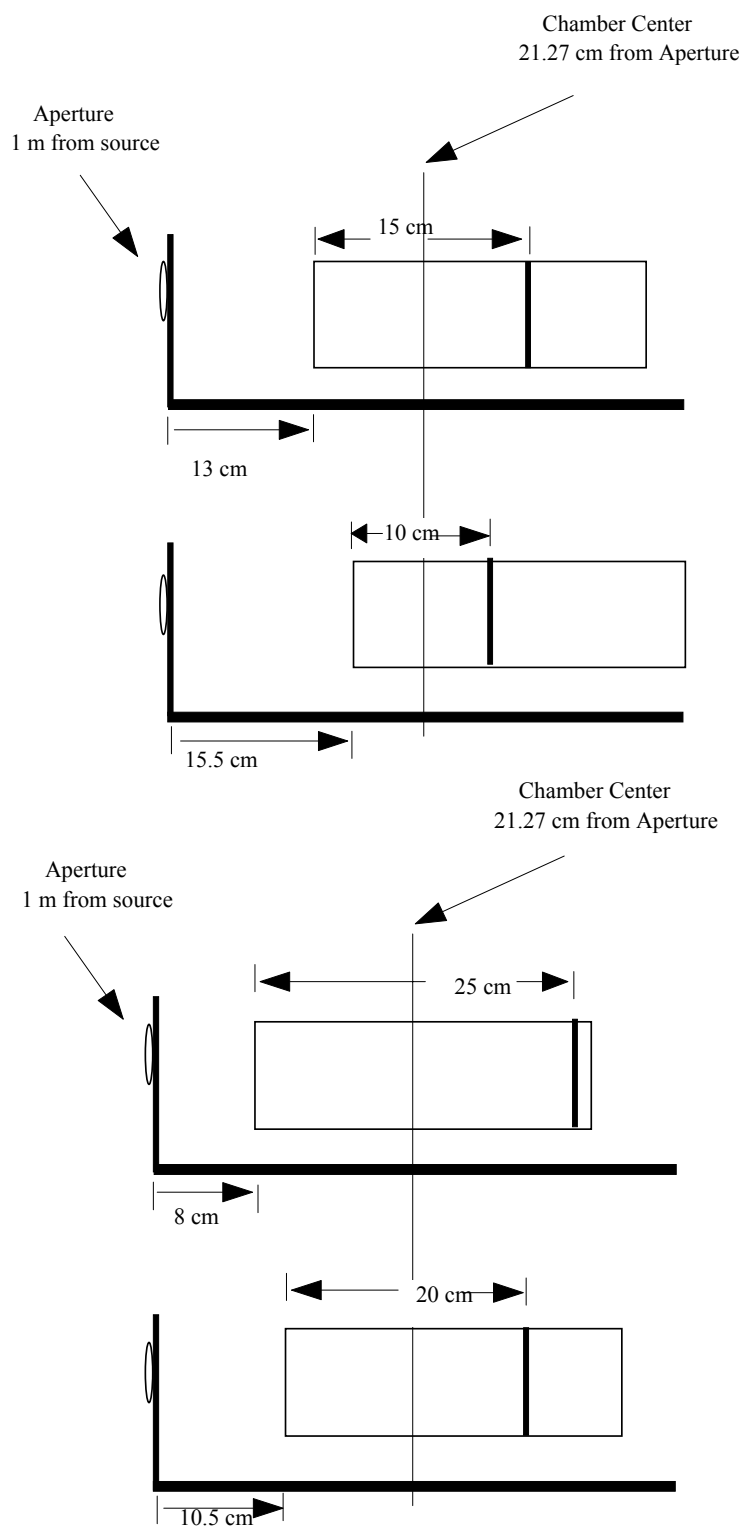


Figure 2. Typical Attix chamber configuration for air-kerma measurements.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	34 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		



Alignment telescope 300 kV range



Alignment telescope 100 kV range



Chamber alignment controls 300 kV range



Chamber alignment controls 100 kV range

Figure 3. Alignment controls for the calibration procedures.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	35 of 60	Procedure03v200

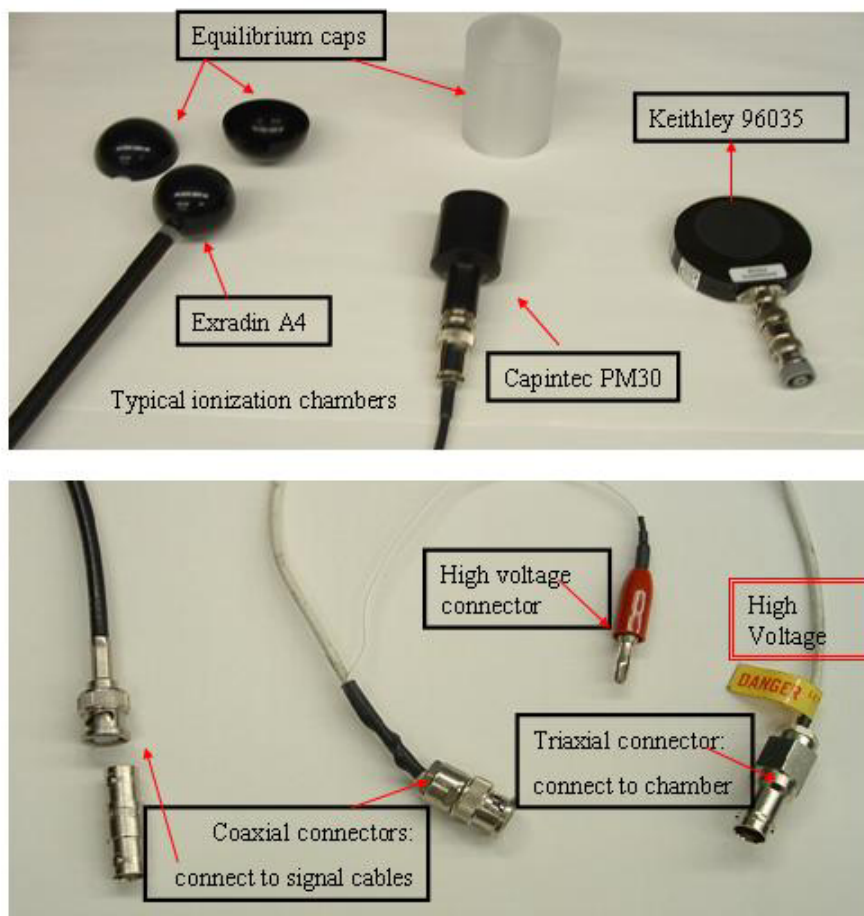


Figure 4. Typical chamber and connectors.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	36 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

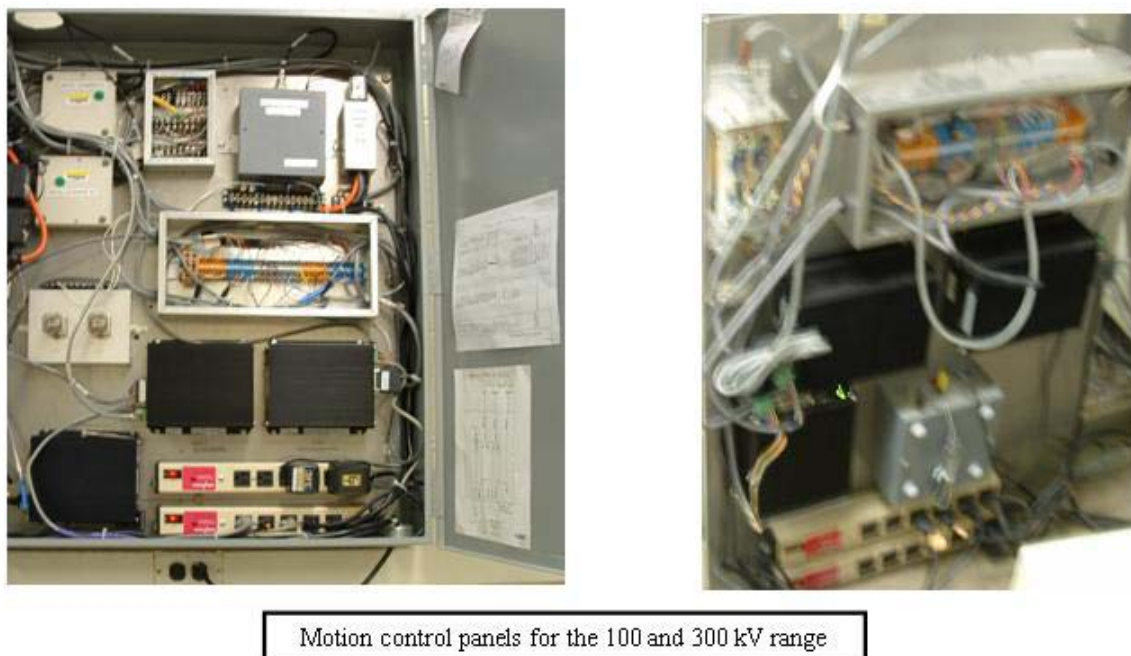


Figure 5. Control panels for the 100 and 300 kV range.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	37 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		



Figure 6. 100-300 kV x-ray controls.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	38 of 60	Procedure03v200




Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		



Figure 7. 100-300kV control. panel and range control.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	39 of 60	Procedure03v200

Test chamber voltage sources

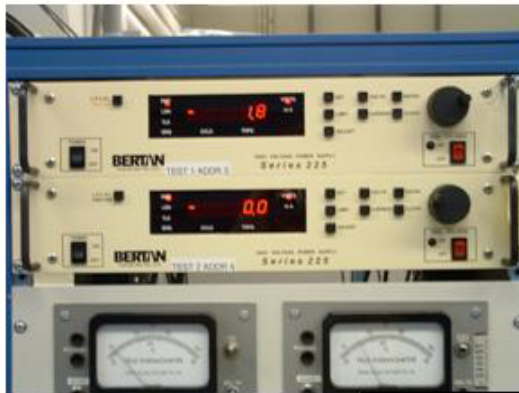

Ritz high voltage source



Wyckoff-Attix high voltage source



Figure 8. 100-300 high voltage power supplies.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	40 of 60	Procedure03v200



Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		



Keithley electrometers



QA barometer



thermometer and barometer

Figure 9. 100-300 kV support calibration equipment.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	41 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		



Alignment telescope mammography range

Chamber alignment controls  
mammography range



Figure 10. Mammography alignment features.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	42 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

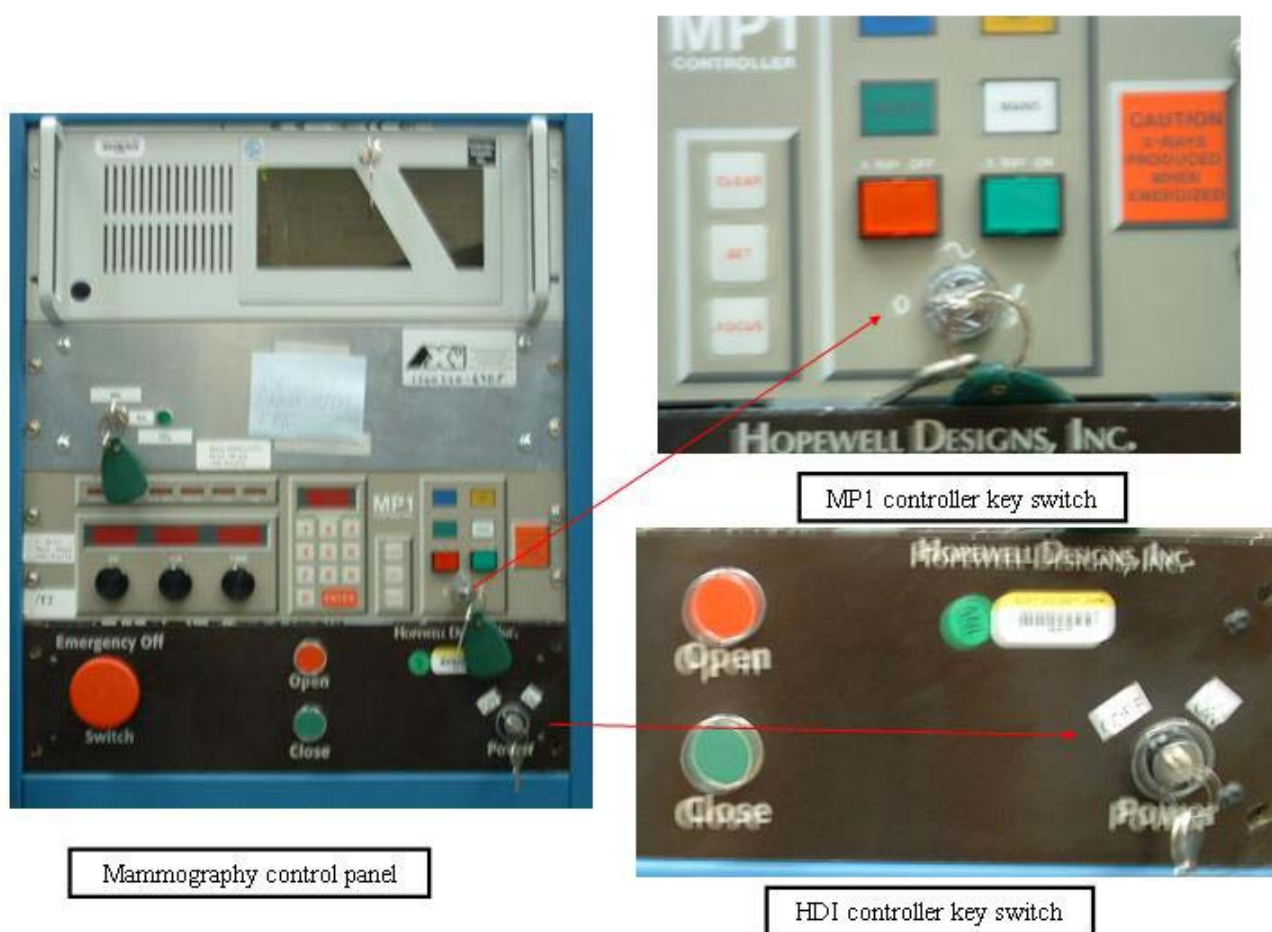


Figure 11. Mammography control panel.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	43 of 60	Procedure03v200

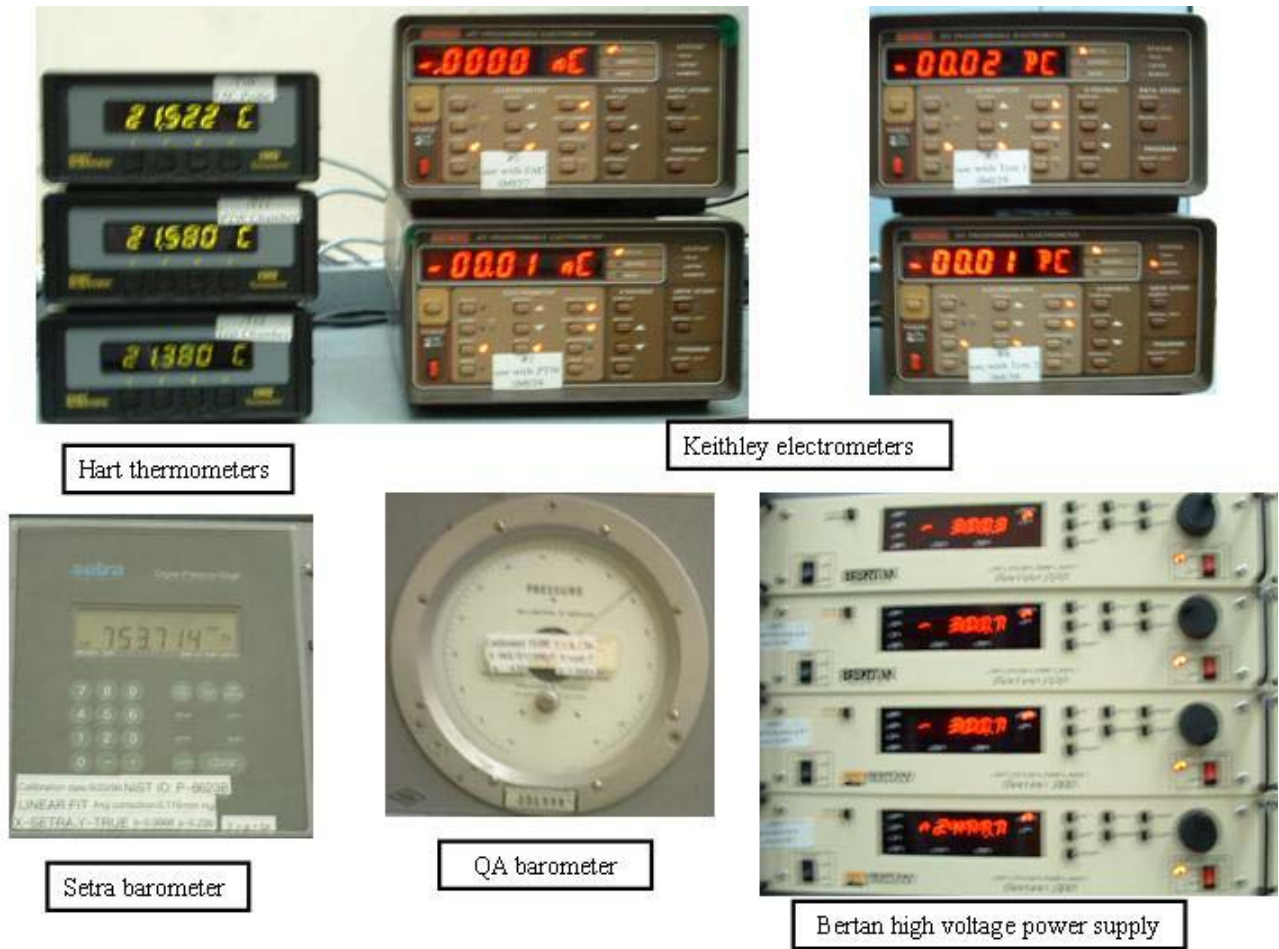


Figure 12. Mammography support equipment.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	44 of 60	Procedure03v200






HP 3456A digital voltmeter



Fluke voltage calibrator

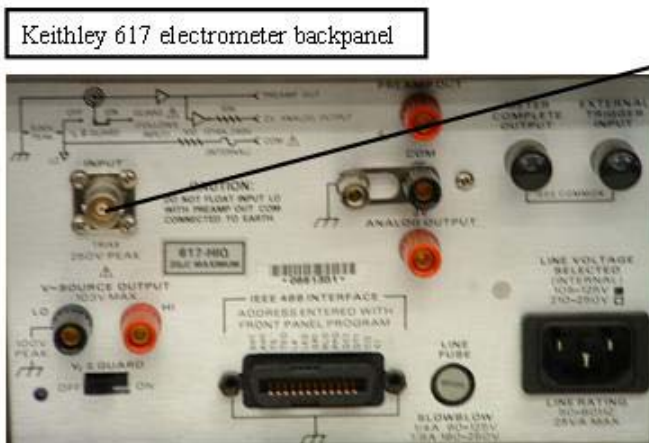

Keithley 617 electrometer backpanel



capacitor

Figure 13. Electrometer calibration setup.

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	45 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

## REFERENCES

1. Marshal, J.L., ed. NIST Calibration Services Users Guide, NIST (U.S.) Spec. Publ. 250; 1998 January. Available on-line: <http://www.ts.nist.gov/calibrations>
2. Boutillon, M. and Perroche-Roux, A.M., Re-evaluation of the W value for electrons in dry air, Phys. Med. Biol., 32, 213-219 (1987).
3. Wyckoff, H. O. and Attix, F. H., Design of free-air ionization chambers, National Bureau of Standards Handbook 64, 1957.
4. Ritz, V. H., Standard free-air chamber for the measurement of low energy x rays (20-100 kilovolts-constant-potential), J. Res. Nat. Bur. Stand. (U.S.), 64C, 49-53 (1960).
5. Lamperti, P. J. and Wyckoff, H. O., NBS free-air chamber for measurement of 10 to 60 kV x rays, J. Res. Nat. Bur. Stand. (U.S.), 69C, 39-47 (1965).
6. Lamperti, P. and O'Brien, M., Calibration of X-Ray and Gamma-Ray Measuring Instruments, NIST Special Publication 250-58, (2001).
13. Attix, F. H., "Electronic equilibrium in free-air chambers and a proposed new chamber design," Naval Research Laboratory Report No. 5646, 1961.
14. Coletti, J.G., Pearson, D. W. and DeWerd, L.A., "Mammography exposure standards: Design and characterization of free-air ionization chamber," Rev. Sci Instrum. 66, 2574-2577 (1995).
16. Burns, D.T., Lamperti, P. and O'Brien, M. "Comparison of the NIST and BIPM Air-Kerma Standards for Measurements in the Low-Energy X-Ray Range," J.Res. Natl. Inst. Stand. Technol. 104, 135 (1999).
17. Lamperti, P., O'Brien, M., Sander, T. And Williams, T. "Comparison of the NIST and NPL Air-Kerma Standards for Measurements in the Low-Energy X-Ray Range," currently in review process.
18. Coletti, J. G., Pearson, D. W., DeWerd, L.A., O'Brien, C. M. and Lamperti, P.J. "Comparison of exposure standards in the mammography x-ray region," Med. Phys. 24(8), 1263-1267 (1997).

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	46 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

Appendix 1: *Sample*

# REPORT OF AIR-KERMA CALIBRATION

OF  
address

**Radiation Detection Chamber: chamber/model**

Calibrations performed by Michelle O'Brien

Report reviewed by Ronaldo Minniti

Report approved by Stephen M. Seltzer

For the Director  
National Institute of Standards and Technology  
by

Lisa R. Karam, Acting Chief  
Ionizing Radiation Division  
Physics Laboratory

Information on technical aspects of this report may be obtained from Michelle O'Brien, National Institute of Standards and Technology, 100 Bureau Drive Stop 8460, Gaithersburg, MD 20899, [michelle.obrien@nist.gov](mailto:michelle.obrien@nist.gov), or (301)975-2014. The results provided herein were obtained under the authority granted by Title 15 United States Code Section 3710a. As such, they are considered confidential and privileged information, and to the extent permitted by law, NIST will protect them from disclosure for a period of five years, pursuant to Title 15 USC 3710a(c)(7)(A) and (7)(B).

*Report format revised 7/03*

DG: 11111/03  
TF number  
03/03/2003  
Page 1 of 11

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	47 of 60	Procedure03v200

# REPORT OF AIR-KERMA CALIBRATION

OF  
address

**Radiation Detection Chamber: chamber/model**

**Chamber orientation:** The cavity was positioned **XXX**

**Chamber collection potential:** A **positive or negative XXX** volts, with respect to the outer electrode was applied to the chamber and **positive or negative** charge was collected by the electrometer.

**Chamber rotation:** The **window faced** the source of radiation.

**Environmental conditions:** The chamber is assumed to be open to the atmosphere.

**Average leakage:** The leakage current is **0.00%** of exposure current.

**Current ratio:** The current ratio at the full to half collection potential is **X.XXX** for an air-kerma rate of **0.0 E-0** Gy/s. A detailed study of ionization recombination was not performed. No recombination correction was applied to the calibration coefficient(s). If the chamber is used to measure an air-kerma rate significantly different from that used for the calibration, it may be necessary to correct for recombination loss.

Beam Code	Half-Value Layer (mm Al)	Calibration Coefficient (Gy/C) 295.15 K (22 °C) and 101.325 Kpa (1 Atm)	Air- Kerma Rate (Gy/s)	Calibration Distance (cm)

DG: 11111/03  
TF number  
03/03/2003  
Page 2 of 11

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	48 of 60	Procedure03v200



Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

### NIST Calibration Conditions for X- and Gamma-Ray Measuring Instruments

Beam code	Additional Filtration <sup>a</sup>				Half-value layer <sup>b</sup> (HVL)		Homogeneity coefficient (HC)		Effective energy (keV)
	Al (mm)	Cu (mm)	Sn (mm)	Pb (mm)	Al (mm)	Cu (mm)	Al	Cu	
X-Ray Beam Qualities									
L10					0.037		86		
L15					0.059		70		
L20					0.070		72		
L30	0.30				0.23		60		
L40	0.53				0.52		61		
L50	0.71				0.79		63		
L80	1.45				1.81		56		
L100	1.98				2.80		58		
M20	0.27				0.15		72		
M30	0.5				0.36		65		
M40	0.89				0.74		67		
M50	1.07				1.04		68		
M60	1.81				1.64	0.052	63	60	
M80	2.86				2.98	0.10	68	61	
M100	5.25				5.00	0.20	74	55	
M120	7.12				6.72	0.31	77	53	
M150	5.25	0.25			10.1	0.66	88	63	
M200	4.35	1.12			14.7	1.64	94	68	
M250	5.25	3.2			18.3	3.2	98	85	
M300	4.25		6.5		21.7	5.3	100	97	
H10	0.105				0.051		77		
H15	0.5				0.16		87		
H20	1.01				0.36		89		
H30	4.50				1.20		86		
H40	4.53	0.26			2.93		94		
H50	4.0			0.1	4.2	0.14	93	93	38
H60	4.0	0.61			6.0	0.25	94	94	46
H100	4.0	5.2			13.4	1.15	97	92	80
H150	4.0	4.0	1.51		16.9	2.43	100	96	120
H200	4.0	0.6	4.16	0.77	19.7	4.10	99	99	166
H250	4.0	0.6	1.04	2.72	22	5.19	99	98	211
H300	4.1		3.0	5.0	23	6.19	99	98	252
S60	4.35				2.79	0.09	76	66	
S75	1.50				1.81		58		
Gamma-Ray Beam Qualities									
<sup>137</sup> Cs						10.8			662
<sup>60</sup> Co						14.9			1250
<sup>a</sup> The additional filtration value does not include the inherent filtration. The inherent filtration is approximately 1.0 mm Be for beam codes L10-L100, M20-M50, H10-H40 and S75; and 3.0 mm Be for beam codes M60-M300, H50-H300 and S60. <sup>b</sup> The HVL values were measured directly using the two new x-ray tubes installed in November of 2001 and May of 2002.									

DG: 11111/03

TF number

03/03/2003

Page 3 of 11

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	49 of 60	Procedure03v100

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

### ISO X-Ray Beam Quality Parameters Offered at NIST

Beam	Additional Filtration (mm) <sup>a</sup>				First HVL <sup>b</sup>		Second HVL <sup>b</sup>	
	Al	Cu	Sn	Pb	mmAl	mmCu	mmAl	mmCu
HK10					0.042		0.045	
HK20	0.15				0.128		0.170	
HK30	0.52				0.408		0.596	
HK60	3.19					0.079		0.113
HK100	3.90	0.15				0.298		0.463
HK200		1.15				1.669		2.447
HK250		1.60				2.463		3.37
HK280		3.06				3.493		4.089
HK300		2.51				3.474		4.205
WS60		0.3				0.179		0.206
WS80 <sup>c</sup>		0.529				0.337		0.44
WS110 <sup>c</sup>		2.029				0.97		1.13
WS150 <sup>c</sup>			1.03			1.88		2.13
WS200 <sup>c</sup>			2.01			3.09		3.35
WS250 <sup>c</sup>			4.01			4.30		4.50
WS300 <sup>c</sup>			6.54			5.23		5.38
NS10	0.095				0.049		0.061	
NS15	0.49				0.153		0.167	
NS20	0.90				0.324		0.351	
NS25	2.04				0.691		0.762	
NS30	4.02				1.154		1.396	
NS40		0.21				0.082		0.094
NS60		0.6				0.241		0.271
NS80 <sup>c</sup>		2.0				0.59		0.62
NS100		5.0				1.14		1.24
NS120		4.99	1.04			1.76		1.84
NS150			2.50			2.41		2.57
NS200 <sup>c</sup>		2.04	2.98			4.09		4.20
NS250			2.01	2.97		5.34		5.40
NS300 <sup>c</sup>			2.99	4.99		6.17		6.30
LK10	0.30				0.061			
LK20	2.04				0.441			
LK30	3.98	0.18			1.492			
LK35		0.25			2.21			
LK55		1.19				0.260		
LK70 <sup>d</sup>		2.64				0.509		
LK100 <sup>d</sup>		0.52	2.0			1.27		
LK125		1.0	4.0			2.107		2.094
LK170		1.0	3.0	1.5		3.565		3.592
LK210		0.5	2.0	3.5		4.726		4.733
LK240		0.5	2.0	5.5		5.515		5.542
<sup>a</sup> The additional filtration does not include the inherent filtration. The inherent filtration is a combination of the filtration due to the monitor chamber plus 1 mm Be for beam codes LK10-LK30, NS10-NS30, HK10-HK30; for all other techniques the inherent filtration is adjusted to 4 mm Al. <sup>b</sup> The HVL values were measured directly using the two new x-ray tubes installed in November of 2001 and May of 2002. <sup>c</sup> Previous HVL values; need to be measured on the new MXR-321 tube. <sup>d</sup> Might be redeveloped using the Wyckoff-Attix rather than the Ritz FAC.								

DG: 11111/03

TF number

03/03/2003

Page 4 of 9

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	50 of 60	Procedure03v100

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

### Mammography X-Ray Beam Quality Parameters

NIST Beam Code	Tube Voltage <sup>1</sup> (kVp)	Added Filter <sup>2</sup> (mm)	Half-Value Layer (mm Al)	Homogeneity Coefficient (Al)
<b>Mo Anode<sup>3</sup></b>				
Mo/Mo23	23	0.032 Mo	0.271	0.702
Mo/Mo25	25	0.032 Mo	0.296	0.719
Mo/Mo28	28	0.032 Mo	0.332	0.743
Mo/Mo30	30	0.032 Mo	0.351	0.752
Mo/Mo35	35	0.032 Mo	0.392	0.784
Mo/Rh28	28	0.029 Rh	0.408	0.796
Mo/Rh32	32	0.029 Rh	0.445	0.821
Mo/Mo25x	25	0.030 Mo + 2.0 Al	0.566	0.91
Mo/Mo28x	28	0.030 Mo + 2.0 Al	0.626	0.964
Mo/Mo30x	30	0.030 Mo + 2.0 Al	0.660	0.947
Mo/Mo35x	35	0.030 Mo + 2.0 Al	0.748	0.902
<b>Rh Anode</b>				
Rh/Rh25	25	0.029 Rh	0.351	0.755
Rh/Rh30	30	0.029 Rh	0.438	0.812
Rh/Rh35	35	0.029 Rh	0.512	0.858
Rh/Rh40	40	0.029 Rh	0.559	0.895
Rh/Rh30x	30	0.029 Rh + 2.0 Al	0.814	0.964
Rh/Rh35x	35	0.029 Rh + 2.0 Al	0.898	0.945

<sup>1</sup>Typical air-kerma rates range between 0.2 and 2 mGy/s, except for exit beams with tube voltages of 30 kVp or less, where the rates do not exceed 0.1 mGy/s.

<sup>2</sup>The inherent filtration is comprised of 1.0 mm Be from the x-ray tube window and 0.075 mm polyamid from the transmission monitor.

<sup>3</sup>Reference beam qualities generated by the molybdenum anode with a nominal focal spot size of 5 x 5 mm.

DG: 11111/03

TF number

03/03/2003

Page 5 of 11

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	51 of 60	Procedure03v100

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

### Explanation of Terms Used in the Calibration Procedures and Tables

**Air Kerma:** The air-kerma rate at the calibration position is measured by a free-air ionization chamber for x radiation and by graphite cavity ionization chambers for  $^{60}\text{Co}$  and  $^{137}\text{Cs}$  gamma radiation, and is expressed in units of grays per second (Gy/s). The gamma-ray air-kerma rates are corrected to the date of calibration (from previously measured values) by decay corrections based on half-lives of 5.27 years for  $^{60}\text{Co}$  and 30.0 years for  $^{137}\text{Cs}$ . For a free-air ionization chamber with measuring volume  $V$ , the air-kerma rate is determined by the relation:

$$\dot{K} = \frac{I}{\rho_{\text{air}} V} \frac{W_{\text{air}}}{e} \frac{1}{1 - g_{\text{air}}} \prod_i k_i$$

where

$I / (\rho_{\text{air}} V)$  is the ionization current, measured by the standard, divided by the mass of air in the measuring volume

$W_{\text{air}}$  is the mean energy expended by an electron of charge  $e$  to produce an ion pair in dry air, the value used at NIST is  $W_{\text{air}}/e = 33.97 \text{ J/C}$

$g_{\text{air}}$  is the fraction of the initial kinetic energy of secondary electrons dissipated in air through radiative processes, the values used at NIST are 0.0032 for  $^{60}\text{Co}$ , 0.0016 for  $^{137}\text{Cs}$  and 0.0 (negligible) for x rays with energies less than 300 keV, and

$\prod k_i$  is the product of the correction factors to be applied to the standard.

Air kerma in grays (Gy) is related to exposure ( $X$ ) in roentgens (R) by the equation:

$$X = \frac{K}{2.58E-4} \frac{1 - g_{\text{air}}}{W_{\text{air}}/e}$$

To obtain exposure in roentgens, divide air kerma in grays by 8.79E-3 for  $^{60}\text{Co}$  gamma rays, 8.78E-3 for  $^{137}\text{Cs}$  gamma rays, and 8.76E-03 for x rays with energies less than 300 keV.

**Beam Code:** The beam code identifies important beam parameters and describes the quality of the radiation field. NIST offers four types of reference beam qualities, as well as the ISO reference radiation qualities. NIST beam codes are referred to as L, M, H, and S beams, which stand for light, moderate, heavy, and special filtration, respectively. The number following the letter is the constant potential across the x-ray tube. The mammography beam codes are a combination of the chemical symbol of the anode and the filter respectively, followed by the constant potential, in kilovolts across the x-ray tube. The exit beam qualities, which represent the transmission of the x-rays through the breast, are created by an additional filtration of 2.0 mm of aluminum. The letter "x" ends the beam codes which refer to exit beam qualities.

**Calibration Distance:** The calibration distance is that between the radiation source and the detector center or the reference line. For thin-window chambers with no reference line, the window surface is the plane of reference. The beam size at the stated distance is appropriate for the chamber dimensions.

DG: 11111/03

TF number

03/03/2003

Page 6 of 11

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	52 of 60	Procedure03v100

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

**Calibration Coefficient:** The calibration coefficients given in this report are quotients of the air kerma and the charge generated by the radiation in the ionization chamber. The average charge used to compute the calibration coefficient is based on measurements with the wall of the ionization chamber at the stated polarity and potential. With the assumption that the chamber is open to the atmosphere, the measurements are normalized to a pressure of one standard atmosphere (101.325 kPa) and a temperature of 295.15 K (22 °C). Use of the chamber at other pressures and temperatures requires normalization of the ion currents to these reference conditions using the normalizing factor  $F$  (see below).

**Effective Energy:** The effective energy is shown for those beams where it is considered a meaningful characterization of the beam quality. The effective energy for gamma radiation is the mean photon energy emitted by the radionuclide, and for x radiation it is computed from good-geometry copper attenuation data. The initial slope of the attenuation curve is used to determine the attenuation coefficient, and the photon energy associated with this coefficient is given as the "effective energy." The energy vs attenuation-coefficient data used for this purpose were taken from J. H. Hubbell, Int. J. Appl. Radiat. Isot. 33, 1269 (1982). For beam codes H50-H300, the effective energy is well represented by the equation: effective energy =  $0.861V - 6.1$  keV where  $V$  is the constant potential in kilovolts.

**Equilibrium Shell:** Added to the nominal wall thickness of the chamber to ensure electronic equilibrium.

**Half-Value Layer:** The half-value layers (HVL) in aluminum and in copper have been determined by measurements with a free-air chamber for x radiation, and have been calculated for the copper HVLs of  $^{60}\text{Co}$  and  $^{137}\text{Cs}$ .

**Homogeneity Coefficient:** The homogeneity coefficient is the quotient of the first HVL and the second HVL, generally expressed as a percent.

**Humidity:** No correction is made for the effect of water vapor on the instrument being calibrated. It is assumed that both the calibration and the use of that instrument take place in air with a relative humidity between 10% and 70%, where the humidity correction is nearly constant.

**Normalizing Factor  $F$ :** The normalizing factor  $F$  is computed from the following expression:

$F = (273.15 + T)/(295.15H)$  where  $T$  is the temperature in degrees Celsius, and  $H$  is the pressure expressed as a fraction of a standard atmosphere. (1 standard atmosphere = 101.325 kilopascals = 1013.25 millibars = 760 millimeters of mercury)

**Uncertainty:** The expanded, combined uncertainty of the calibration described in this report is 1%, of which 0.95% is assigned to the uncertainty in the air-kerma rate of the NIST beam. The expanded, combined uncertainty is formed by taking two times the square root of the sum of the squares of the standard deviations of the mean for component uncertainties obtained from replicate determinations, and assumed approximations of standard deviations for all other uncertainty components; it is considered to have the approximate significance of a 95% confidence limit. Details of the uncertainty analysis are given in: Lamperti, P.J., O'Brien, M., "Calibration of X-Ray and Gamma-Ray Measuring Instruments," NIST Special Publication 250-58 (2001).

DG: 11111/03

TF number

03/03/2003

Page 7 of 11

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	53 of 60	Procedure03v100

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

The Radiation Interactions and Dosimetry Group of the NIST Ionizing Radiation Division has made a change in its terminology in calibration and special test reports pertaining to photon and electron dosimetry. This change in terminology is in effect as of 1 May 2002. The proposed changes are based on recommendations in ISO 31-0 (1992) that have been followed for some years now by a number of other international organizations: a quantity with dimensions should be termed a “coefficient,” and a quantity that is dimensionless should be termed a “factor.”

In this revised terminology, the calibration quantity is defined as the conventional true value of the quantity the instrument is intended to measure, divided by the instrument's reading; this calibration ratio is termed a *coefficient* if it has dimensions or a *factor* if it is dimensionless.

Thus: (a) For our x-ray and gamma-ray calibrations of ionization chambers, for which the calibration ratio has dimensions of gray (or roentgen) per coulomb, the reported quantity is a *calibration coefficient*, rather than the old calibration factor.

(b) For calibrations of instruments that read directly in absorbed dose, kerma or exposure, or their rates, for which the calibration ratio is dimensionless, the reported quantity is a *calibration factor*, rather than the old correction factor.

(c) Other similar calibrations, such as for well-chambers used in brachytherapy dosimetry, will also incorporate these changes.

This change should provide improved clarity in our calibration reports, removing any possible confusion between a reported calibration correction factor (using the old terminology) and those correction factors (*e.g.*, for pressure, temperature, saturation) used in the calibration procedures.

The change in terminology is intended to be benign. *The meaning of the reported calibration quantity has not changed.* The correspondence with the older terminology is outlined above to establish the equivalence of the new terms for those concerned with satisfying, to the letter, documentary standards and protocols.

Stephen M. Seltzer  
Leader, Radiation Interactions and Dosimetry Group

DG: 11111/03  
TF number  
03/03/2003  
Page 8 of 11

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	54 of 60	Procedure03v100

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

**Corrected Note on Change of NIST X-Ray Beam Standards  
14 May 2004**

In the summer of 2003, we issued a number of tables indicating the changes in NIST standards for air kerma (exposure) for low-energy and medium-energy x-ray beams. The basis for the change is indicated below, in text similar to the earlier distributions. However, on careful review we found that some of the net changes reported earlier were in error, mainly because they were based on misquoted "previous" values. In order to consistently correct this information and to provide factors less subject to misunderstanding, new tables are given below. Note that these tables supersede all earlier versions.

The National Institute of Standards and Technology has revised its air-kerma (exposure) standards for x-ray beams, as of January 1, 2003. The changes are due to the implementation of correction factors for free-air chambers from Monte Carlo calculations, reported by David Burns of the Bureau International des Poids et Mesures (BIPM) at the 1999 and 2001 meetings of the Consultative Committee on Ionizing Radiation (Section I) [1,2]. These data, as a function of incident photon energy from 10 keV to 300 keV, pertain to the three NIST standards, the Lamperti (up to 50 keV), Ritz (up to 100 keV) and Wyckoff-Attix (up to 300 keV) free-air chambers. The values of the photon-scatter correction  $k_{sc}$  and the electron-loss correction  $k_e$  have been changed and a new fluorescence correction  $k_f$  has been implemented. Using a library of photon spectra derived by others [3] from measurements, the corrections for our standard free-air chambers have been calculated for the beam qualities maintained by NIST, including also calculated attenuation corrections  $k_{att}$ . As described in references [4, 5], previously at NIST  $k_e$  and  $k_{sc}$  were derived from the data in references [6-9] ( $k_{att}$  was derived from measurements), with the final determinations depending to varying degrees on skillful curve fitting and interpolation. This old procedure was used to make some intermediate changes to correction factors during the last few years, occasioned by the reestablishment of calibration beam qualities after replacement of x-ray-generating equipment.

NIST adopts the Monte Carlo data provided by the BIPM in conjunction with the available x-ray beam spectra for the determination of  $k_{sc}$ ,  $k_e$ , and  $k_f$ , along with a blend of measured and calculated values for  $k_{att}$ . The changes to the NIST standards are indicated in the tables that follow. The air-kerma rates have been adjusted due to the implementation of the new correction factors for all reports of air-kerma issued after January 1, 2003.

#### References

- [1] D.T. Burns, "Consistent set of calculated values for electron-loss and photon-scatter corrections for parallel-plate free-air chambers," CCRI(I)/99-4 (1999).
- [2] D.T. Burns, "The re-absorption of fluorescence photons in free-air chambers," CCRI(I)/01-32 (2001).
- [3] See, e.g., W.W.Seelentag, W. Panzer, G. Drexler, L. Platz and F. Santner, *A Catalogue of Spectra for the Calibration of Dosimeters*, GSF Report 560 (1979). Electronic files provided by C.G. Soares (private communication).
- [4] P.J. Lamperti, T.P. Loftus and R. Loevinger, *Calibration of X-Ray and Gamma-Ray Measuring Instruments*, NBS Special Publication 250-16 (1988).
- [5] P.J. Lamperti and M. O'Brien, *Calibration of X-Ray and Gamma-Ray Measuring Instruments*, NIST Special Publication 250-58 (2001).
- [6] V.H. Ritz, "Standard free-air chamber for the measurement of low-energy x rays (20-100 kilovolts-constant-potential)." J. Res. NBS **64C**, 49-53 (1960).
- [7] H.O. Wyckoff and F.H. Attix, *Design of free-air ionization chambers*, NBS Handbook 64 (1957).
- [8] A. Allisy and A.M. Roux, "Contribution a la mesure des rayons roentgen dans le domaines de 5 a 50 kV," *Acta Radiologica* **55**, 57-74 (1961).
- [9] V.H. Ritz, "Design of free-air ionization chambers for the soft x-ray region (20-100 kV)," *Radiology* **73**, 911-922 (1959).

DG: 11111/03

TF number

03/03/2003

Page 9 of 11

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	55 of 60	Procedure03v100

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

Table 1. NIST x-ray beam quality parameters and *corrected* changes in standards, 1 January 2003.

Beam code	Additional filtration <sup>a</sup>				Half-value layer <sup>b</sup> (HVL)		Homogeneity coefficient (HC)		Effective energy (keV)	Total relative change <sup>c</sup> (%)
	Al (mm)	Cu (mm)	Sn (mm)	Pb (mm)	Al (mm)	Cu (mm)	Al	Cu		
L10					0.037		86			-0.30
L15					0.059		70			-0.19
L20					0.070		72			-0.31
L30	0.30				0.23		60			+0.03
L40	0.53				0.52		61			+0.60
L50	0.71				0.79		63			+0.04
L80	1.45				1.81		56			+0.06
L100	1.98				2.80		58			+0.22
M20	0.27				0.15		72			-0.22
M30	0.5				0.36		65			-0.16
M40	0.89				0.74		67			+0.37
M50	1.07				1.04		68			+0.20
M60	1.81				1.64	0.052	63	60		-0.30
M80	2.86				2.98	0.10	68	61		-0.13
M100	5.25				5.00	0.20	74	55		-0.01
M120	7.12				6.72	0.31	77	53		-0.04
M150	5.25	0.25			10.1	0.66	88	63		-0.15
M200	4.35	1.12			14.7	1.64	94	68		+0.02
M250	5.25	3.2			18.3	3.2	98	85		+0.24
M300	4.25		6.5		21.7	5.3	100	97		+0.76
H10	0.105				0.051		77			-0.26
H15	0.5				0.16		87			-0.15
H20	1.01				0.36		89			-0.14
H30	4.50				1.20		86			-0.07
H40	4.53	0.26			2.93		94			-0.05
H50	4.0			0.1	4.2	0.14	93	93	38	-0.14
H60	4.0	0.61			6.0	0.25	94	94	46	-0.17
H100	4.0	5.2			13.4	1.15	97	92	80	-0.06
H150	4.0	4.0	1.51		16.9	2.43	100	96	120	-0.03
H200	4.0	0.6	4.16	0.77	19.7	4.10	99	99	166	+0.12
H250	4.0	0.6	1.04	2.72	22	5.19	99	98	211	+0.56
H300	4.1		3.0	5.0	23	6.19	99	98	252	+1.85
S60	4.35				2.79	0.09	76	66		-0.10
S75	1.50				1.81		58			+0.04

<sup>a</sup> The additional filtration value does not include the inherent filtration. The inherent filtration is approximately 1.0 mm Be for beam codes L10-L100, M20-M50, H10-H40 and S75; and 3.0 mm Be for beam codes M60-M300, H50-H300 and S60.

<sup>b</sup> The HVL values were measured directly using the two new x-ray tubes installed in November of 2001 and May of 2002.

<sup>c</sup> Total change includes that due to changes in  $k_{att} \cdot k_e \cdot k_{sc} \cdot k_f$ , assuming an air density of 0.0011965 g/cm<sup>3</sup> in the evaluation of  $k_{att}$ . The total relative change in % is  $100(\Pi k_{new}/\Pi k_{old}-1)$ , or  $100(K_{new}/K_{old}-1)$ , where  $K$  is the air kerma measured using the indicated standard.

DG: 11111/03

TF number

03/03/2003

Page 10 of 11

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	56 of 60	Procedure03v100



Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

Table 2. ISO x-ray beam quality parameters and *corrected* changes in standards, 1 January 2003.

Beam Code	Additional filtration (mm) <sup>a</sup>				First HVL <sup>b</sup>		Second HVL <sup>b</sup>		Total relative change <sup>c</sup> (%)
	Al	Cu	Sn	Pb	Al (mm)	Cu (mm)	Al (mm)	Cu (mm)	
HK10					0.042		0.045		-0.59
HK20	0.15				0.128		0.170		-0.43
HK30	0.52				0.408		0.596		-0.33
HK60	3.19					0.079		0.113	-0.23
HK100	3.90	0.15				0.298		0.463	-0.11
HK200		1.15				1.669		2.447	-0.02
HK250		1.60				2.463		3.37	-0.01
HK280		3.06				3.493		4.089	+0.00
HK300		2.51				3.474		4.205	-0.01
WS60		0.3				0.179		0.206	-0.12
WS80		0.529				0.337		0.44	-0.10
WS110		2.0295				0.97		1.13	-0.04
WS150			1.03			1.88		2.13	-0.02
WS200			2.01			3.09		3.35	+0.00
WS250			4.01			4.30		4.50	+0.00
WS300			6.54			5.23		5.38	+0.00
NS10	0.095				0.049		0.061		-0.56
NS15	0.49				0.153		0.167		-0.42
NS20	0.90				0.324		0.351		-0.34
NS25	2.04				0.691		0.762		-0.29
NS30	4.02				1.154		1.396		-0.23
NS40		0.21				0.082		0.094	-0.17
NS60		0.6				0.241		0.271	-0.10
NS80		2.0				0.59		0.62	-0.07
NS100		5.0				1.14		1.24	-0.03
NS120		4.99	1.04			1.76		1.84	-0.01
NS150			2.50			2.41		2.57	-0.01
NS200		2.04	2.98			4.09		4.20	+0.00
NS250			2.01	2.97		5.34		5.40	+0.00
NS300			2.99	4.99		6.17		6.30	+0.00
LK10	0.30				0.061				-0.53
LK20	2.04				0.441				-0.31
LK30	3.98	0.18			1.492				-0.22
LK35		0.25			2.21				-0.19
LK55		1.19				0.260			-0.10
LK70		2.64				0.509			-0.06
LK100		0.52	2.0			1.27			-0.02
LK125		1.0	4.0			2.107		2.094	-0.01
LK170		1.0	3.0	1.5		3.565		3.592	+0.00
LK210		0.5	2.0	3.5		4.726		4.733	+0.00
LK240		0.5	2.0	5.5		5.515		5.542	+0.00

<sup>a</sup> The additional filtration does not include the inherent filtration. The inherent filtration is a combination of the filtration due to the monitor chamber plus 1 mm Be for beam codes LK10-LK30, NS10-NS30, HK10-HK30; for all other techniques the inherent filtration is adjusted to 4 mm Al.

<sup>b</sup> The HVL values were measured directly for the two new x-ray tubes installed in November 2001 and in May 2002.

<sup>c</sup> New values of  $k_{att}$ ,  $k_{cs}$ , and  $k_{sc}$  have been used since July 2001, *i.e.*, for all calibrations;  $k_{fl}$  was introduced January 2003. Thus the relative change (in %) to disseminated standards is effectively  $100(k_{fl}-1)$ , values of which are listed in this column.

DG: 11111/03

TF number

03/03/2003

Page 11 of 11

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	57 of 60	Procedure03v100

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

Appendix 2:

# *Sample*

## REPORT OF ELECTROMETER TEST

For

Customer Address  
**Electrometer: model and SN**

Test performed by Michelle O'Brien

Report reviewed by Ronaldo Minniti

Report approved by Stephen M. Seltzer

For the Director  
National Institute of Standards and Technology  
by

Lisa R. Karam, Acting Chief  
Ionizing Radiation Division  
Physics Laboratory

Information on technical aspects of this report may be obtained from Michelle O'Brien, National Institute of Standards and Technology, 100 Bureau Drive Stop 8460, Gaithersburg, MD 20899, [michelle.obrien@nist.gov](mailto:michelle.obrien@nist.gov), or (301)975-2014. The results provided herein were obtained under the authority granted by Title 15 United States Code Section 3710a. As such, they are considered confidential and privileged information, and to the extent permitted by law, NIST will protect them from disclosure for a period of five years, pursuant to Title 15 USC 3710a(c)(7)(A) and (7)(B).

*Report format revised 8/03*

DG: xxxxx/03  
TFn-03  
00/00/2003  
Data Book 901: pg  
Page 1 of 3

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	58 of 60	Procedure03v100

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

## REPORT OF ELECTROMETER TEST

For

Customer Address

**Electrometer: model and SN**

The referenced electrometer has been tested for use with the ionization chamber covered by **Report of Air Kerma Calibration DG XXXXX/03**. The electrometer was tested with the following combination of switch positions:

Switch	Position
Bias	Off
Feedback	Fast
Mode	Coul
Polarity	tested each
Range	E-9
Selector	10 v

Measurements made with the test instrument, Keithley 617 electrometer, were found to be consistent with the calibration coefficient obtained with the NST electrometer, refer to in the **Report of Air Kerma Calibration DG XXXXX/XX**.

The electrometer measurements should be corrected by  $C_Q$ , which was determined by applying a known charge to the electrometer input and observing the corresponding charge reading.

Calibration Factor $C_Q$
0.XXX

The air kerma rate at the reference point of the ionization chamber is :

$$\dot{K} = C_Q \cdot F \cdot Q \cdot N$$

where,

$F$  is the temperature-pressure normalizing factor

$Q$  is the change in charge on the electrometer system as indicated by the meter readings

$N$  is the chamber calibration coefficient in terms of air kerma per unit charge for the stated conditions of calibration.

DG: xxxxx/03

TFn-03

00/00/2003

Data Book 901: pg

Page 2 of 3

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	59 of 60	Procedure03v200

Ionizing Radiation Division	46010C, 46011C	IRD-P-03
CALIBRATION OF X-RAY RADIATION DETECTORS		

## Explanation of Terms Used in the Test Report

**Air Kerma:** The air-kerma rate at the calibration position is measured by a free-air ionization chamber and is expressed in units of grays per second (Gy/s). For a free-air ionization chamber with measuring volume  $V$ , the air-kerma rate is determined by the relation:

$$\dot{K} = \frac{I}{\rho_{\text{air}} V} \frac{W_{\text{air}}}{e} \frac{1}{1 - g_{\text{air}}} \prod_i k_i$$

where

$I / (\rho_{\text{air}} V)$  is the ionization current, measured by the standard, divided by the mass of air in the measuring volume

$W_{\text{air}}$  is the mean energy expended by an electron of charge  $e$  to produce an ion pair in dry air, the value used at NIST is  $W_{\text{air}}/e = 33.97 \text{ J/C}$

$g_{\text{air}}$  is the fraction of the initial kinetic energy of secondary electrons dissipated in air through radiative processes which is 0.0 (negligible) for x rays with energies less than 300 keV, and

$\prod k_i$  is the product of the correction factors to be applied to the standard.

Air kerma in grays (Gy) is related to exposure ( $X$ ) in roentgens (R) by the equation:

$$X = \frac{\dot{K}}{2.58E-4} \frac{1 - g_{\text{air}}}{W_{\text{air}}/e}$$

To obtain exposure in roentgens, divide air kerma in grays by  $8.76E-03$  for x rays with energies less than 300 keV.

**Calibration Coefficient N:** The calibration coefficients referenced in this report are quotients of the air kerma and the charge generated by the radiation in the ionization chamber. See the previously referenced NIST calibration report.

**Normalizing Factor F:** The normalizing factor  $F$  is computed from the following expression:  $F = (273.15 + T)/(295.15H)$  where  $T$  is the temperature in degrees Celsius, and  $H$  is the pressure expressed as a fraction of a standard atmosphere. (1 standard atmosphere = 101.325 kilopascals = 1013.25 millibars = 760 millimeters of mercury)

**Uncertainty:** The expanded, combined uncertainty of the calibration described in this report is X%. The expanded, combined uncertainty is formed by taking two times the square root of the sum of the squares of the standard deviations of the mean for component uncertainties obtained from replicate determinations, and assumed approximations of standard deviations for all other uncertainty components; it is considered to have the approximate significance of a 95% confidence limit. Details of the uncertainty analysis are given in: Lamperti, P.J., O'Brien, M., "Calibration of X-Ray and Gamma-Ray Measuring Instruments," NIST Special Publication 250-58 (2001).

DG: xxxxx/03

TFn-03

00/00/2003

Page 3 of 3

Version	Date	Author	Approval	Pages	Filename
2.00	6/1/2004	CMO	Uncontrolled copy	60 of 60	Procedure03v200